

Read this manual before operation

- The content include of electric connections and operating steps
- Read the manual to operate the systems

# RDC6585PC

Control System manual V1.0

## RuiDa Technology Co., Ltd

Addr: 3th floor,Technology Building,NO.,1067 Nanhai  
Avenue,Nanshan District,Shenzhen city,Guangdong  
Province,P.R.China

Tel: 0755--26066687

Fax: 0755--26982287

E-mail: [sales@rd-ac.com](mailto:sales@rd-ac.com)

Web: [www.rd-ac.com](http://www.rd-ac.com)



# COPYRIGHT

■ All rights reserved. You may not reproduce, transmit, store in a retrieval system or adapt this publication, in any form or by any means, without the prior written permission of RuiDa, except as allowed under applicable copyright laws. We have identified words that we consider as trademarks. Neither the presence or absence of trademark identifications affects the legal status of any trademarks.



# CERTIFICATION DECLARATION



## CE

The product has been certified by the CE (Communate European) safety certification. It has passed the corresponding conformity assessment procedure and the manufacturer's declaration of conformity, in accordance with the relevant EU directive.



## ROHS

This product has been certified by EU legislation (Restriction of Hazardous Substances) Safety certification; comply with relevant EU environmental regulations.



## FCC

This product has been certified by the Federal Communications Commission for safety, Comply with us electronic safety regulations.

# SAFETY INFORMATION

When using this system, please make sure the operation is correct and the usage is safe. Some signs or text will be used to remind you to pay attention to the dangerous matters and some important information.

**Dangerous:**

Indicates a serious danger. In the process of use, if the operation is improper or the way of use is wrong, it may cause serious injury or even death to the user. Please do not operate it easily until you have made sure that the operation method is correct and the way of use is correct.

**Warning:**

Danger.n the process of use, if the operation is improper or the use is wrong, which may lead to the injury of the personnel, please do not operate the personnel and related personnel easily, until ensure the correct operation method and use method is correct before use.

**Cautious:**

Represents the potential risk of the product. In the process of use, if the use method is wrong or improper operation, it may cause damage to the product or some parts. Please do not use it until you have made sure that the operation method is correct and the usage is correct.

**Important:**

Represents important information to be paid attention to during the use of the product. Please do not ignore this information, this information will provide effective operational help.



This sign indicates laser radiation, which is usually posted on products with laser output. Please be careful with laser and pay attention to safety when using this kind of equipment.



## Sign in、Devanning、Examine cargo

The product itself with plastic or metal shell, can protect the external electrical components from damage. The products are packed in foam bags and anti-static bags. If there is any external damage to the package, check the equipment and notify the carrier and carrier in writing of the damage.

### **Important:**



After receiving the product, please check whether the outer package is intact, check whether the product is complete after unpacking and whether all parts are intact. If any damage is found, please contact ruida immediately.

Remove all cargo from package and keep packing material and wiring parts. Please take care of the safety of the goods when unpacking them. After taking out the goods, please check whether the parts are complete and intact. If any missing parts or damaged parts are found, please contact ruida technology immediately. Do not install or debug the equipment if any obvious damage is found.

# CONTENTS

Section 1 Overview.....	1
1.1 BRIEFING.....	2
1.2 DESCRIPTION OF CONTROLLER MODEL.....	2
1.3 COMPARISON OF CONTROLLER PERFORMANCE.....	2
Section 2 Installation Size.....	4
2.1 INSTALLATION SIZE OF MAINBOARD.....	5
2.2 SIZE OF PANEL.....	6
Section 3 Object Pictures and Interfaces.....	7
.....	8
3.1 OBJECT PICTURES OF MAINBOARD.....	8
3.2 OBJECT PICTURES OF PANEL.....	9
3.3 ELECTRIC CONNECTION.....	10
3.4 LAMP INSTRUCTION.....	11
3.5 FUNCTION DISTRIBUTION OF ALL EIGHT AXES.....	12
Section 4 Description of Interface Signal for MainBoard.....	13
.....	15
4.1 INTERFACE OF MAIN POWER SOURCE CN0.....	15
4.2 PANEL SIGNAL-CABLE INTERFACE HMI.....	15
4.3 UDISK INTERFACE.....	15
4.4 PC-USB INTERFACE.....	15
4.5 ETHERNET INTERFACE.....	15
4.6 EXTENDED EQUIPMENT INTERFACE CN1.....	15
4.7 OUTPUT PORT CN2/CN3.....	16
4.8 INPUT PORT CN4.....	17
4.9 8-AXLE SPACING INPUT INTERFACE.....	18
4.10 X~D AXLE MOTOR DRIVER INTERFACE AXIS_X~AXIS_D.....	18
4.11 LASER POWER CONTROL INTERFACE LP1~LP6.....	19
Section 5 Examples of Laser Power Interface.....	21
5.1 BRIEF.....	22
5.2 EXAMPLES OF GLASS TUBE LASER POWER.....	22
5.3 EXAMPLES OF RF-LASER.....	23
Section 6 Examples of Driver Interface for Step-servo Motor.....	24
.....	24
6.1 BRIEF.....	25
6.2 EXAMPLES OF MOTOR DRIVER CONNECTION.....	26
Section 7 Examples of Extended Equipment Interface.....	27
7.1 EXAMPLES OF EXTENDED EQUIPMENT INTERFACE.....	28
Section 8 Operating Instruction of Panel.....	28
8.1 BRIEF.....	29
8.1.1 Overview.....	29
8.1.2 Introduction to the Keys.....	29
8.1.3 THE MAIN INTERFACE.....	31

---

8.2 SPEED SETTING.....	32
8.3 SET THE LAYER PARAMETERS.....	32
8.4 MENU FUNCTION.....	34
8.4.1 Focusing.....	34
8.4.2 Max/Min Power Setting.....	34
8.4.3 User parameters.....	35
8.4.4 Vender parameters.....	38
8.4.5 Origin Setting.....	39
8.4.6 Backup parameters.....	41
8.4.7 Restore parameters.....	42
8.5 CONTROLLER SETTING.....	42
8.5.1 Language.....	42
8.5.2 Screen origin.....	43
8.5.3 Wireless panel.....	44
8.5.4 IP Setting.....	44
8.5.5 System Info.....	45
8.6 FUNCTIONS.....	45
8.6.1 Axis reset.....	46
8.6.2 Keyboard lock.....	46
8.6.3 Manual setting.....	47
8.6.4 Laser Setting.....	47
8.6.5 Spray setting.....	48
8.6.6 Drip setting.....	49
8.6.7 Diagnose.....	49
8.6.8 Laser power infomation.....	50
8.7 FILE MANAGEMENT.....	51
8.7.1 Memory File.....	51
8.7.2 Array info.....	52
8.7.3 Feeding para.....	53
8.7.4 Memory operation.....	54
8.7.5 Format memery.....	54
8.7.6 U disk file.....	55
8.8 PASSWORD INPUT AND SETTINGS.....	56
8.8.1 Password Input.....	56
8.8.2 Password Setting.....	56
8.9 PROMPT AND ALARM INFORMATION.....	57
Section 9 Manufacturer/User Parameters Explanation.....	58
9.1 MANUFACTURER PARAMETERS.....	59
9.2 USER PARAMETERS.....	63

# Section 1 Overview

## CONTENTS:

- Briefing
- Description of  
Controller Model
- Comparison of  
Controller Performance


## 1.1 Briefing

RDC6585PC system is a new generation of spray cutting integrated control system developed by Ruida technology. The man-machine operating system based on 5-inch color screen has more friendly operation interface and more powerful functions. The controller has perfect and excellent motion control function, which can realize laser processing and glue spraying processing respectively by layers. The control system has multiple general / special IO control interfaces and multiple peripheral interconnection interfaces.

The controller can be used for single path laser + glue spraying processing, and can also be used to drive single / multiple belt type double head mutual moving machine. At most, it can realize mutual moving processing of two paths laser and mutual moving processing of two paths glue spraying by layers.

## 1.2 Description of Controller Model

### RDC6585PC

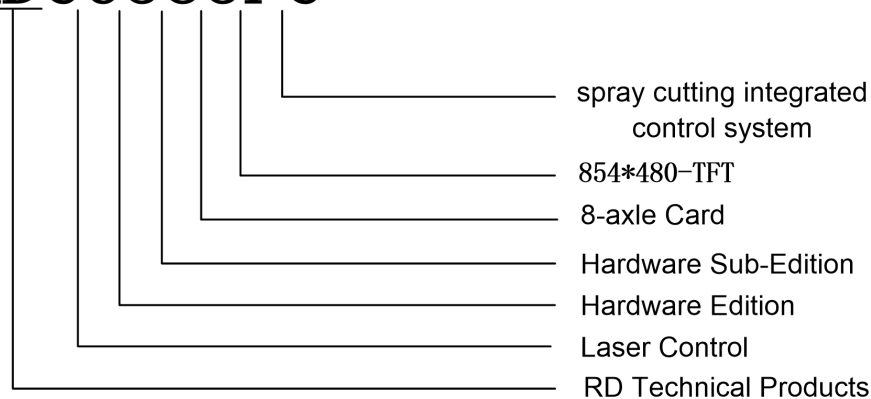

## 1.3 Comparison of Controller Performance

		RDC6585PC
<b>Power Feature</b>		<i>Only one-way 24V</i>
<b>Laser Port Feature</b>		<i>Six-way digits port, settable independently and non-interacted</i>
<b>USB Feature</b>	Copying Speed	<i>Very High</i>
	Compatibility	<i>Support all USB disks with different capacities</i>
<b>Memory</b>	Capacity	<i>256M</i>

<b>Feature</b>	Fault Tolerance	<i>Capable of checking defective track and formatting and good in fault tolerance</i>
<b>General IO Feature</b>	Input Port	<i>Multiple dedicated + general input (compatible with 5 / 12 / 24V logic level)</i>
	Output Port	<i>Multiple dedicated + general output (drive capacity 500mA, OC output, continuous current protection)</i>
<b>Software Feature</b>	Power-off restart for Engraving	YES
	Multi-origin Logics	YES
	Parameter Backup Logics	YES
	Work time Preview	YES (the work time accurate to 1ms)
	Online Update Mainboard Program	YES
<b>Display Feature</b>	Online Modification Laser Power/Speed	YES
	Offline Modification Layer parameters	YES
	Online Update Startup Display	NO
	File dynamic/static preview	YES
	Run progress bar display	YES
	Modification Factory/User's para on display	Yes
	Display type	320*480 TFT display
<b>Motion-axle Feature</b>	Soft Spacing	YES
	Hard Spacing	YES
	Feeding Feature	<i>Single/double direction for option</i>
	Power-on Resetting	<i>Configurable for each axes</i>
	Key Speed	<i>Configurable</i>
	Axles	8
	Robotization Multi-X axes Support	2
	Belt of Multi-X axes	<i>Single or Multi- Belt</i>
<b>Encryption Feature</b>		<i>encryption included</i>
<b>Communicate Mode</b>		<i>10/100MHZ Ethernet or USB2.0, communication mode is automatically checked</i>
<b>Extended Communication Ports</b>		<i>Two ways For wireless handset, EPLC400 or other equipment</i>
<b>Phone App Support</b>		YES

# Section 2 Installation Size

## CONTENTS:

- Installation Size of  
MainBoard
- Size of Panel

## 2.1 Installation Size of MainBoard

The unit of all sizes is millimeter (mm) and the size accurate to 0.1mm (the four holes are symmetrical)

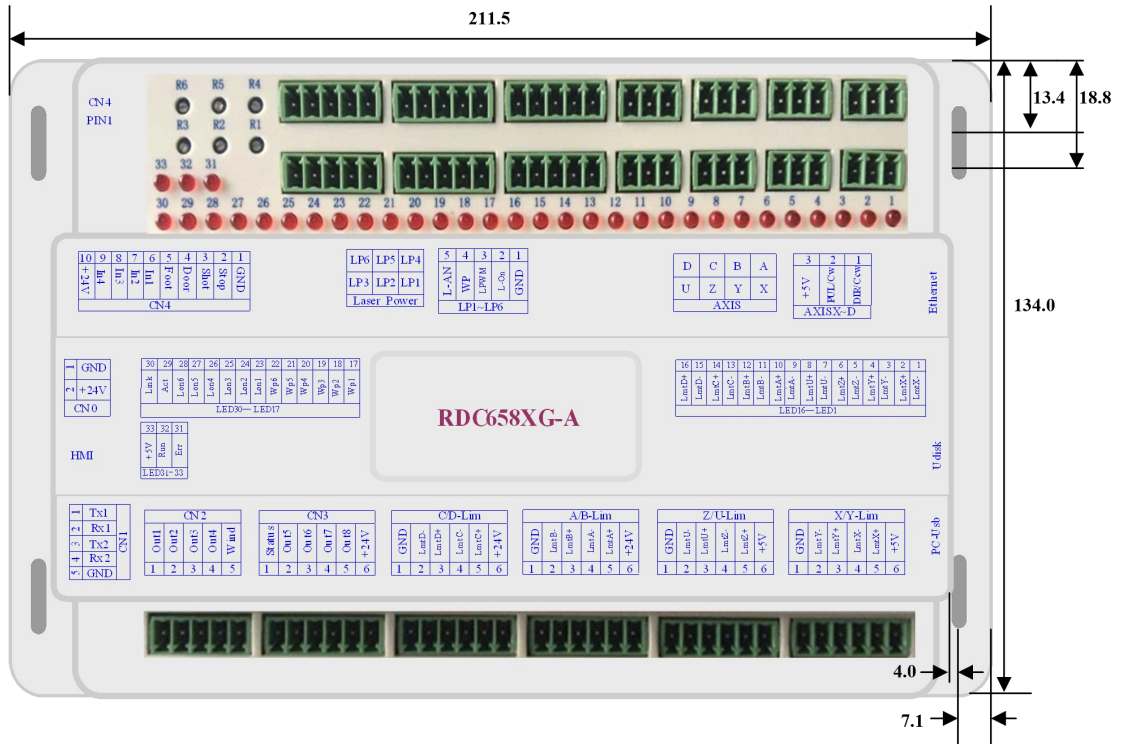


Figure 2.1-1



## 2.2 Size of Panel

The unit of all sizes is millimeter (mm) and the size accurate to 0.1mm.

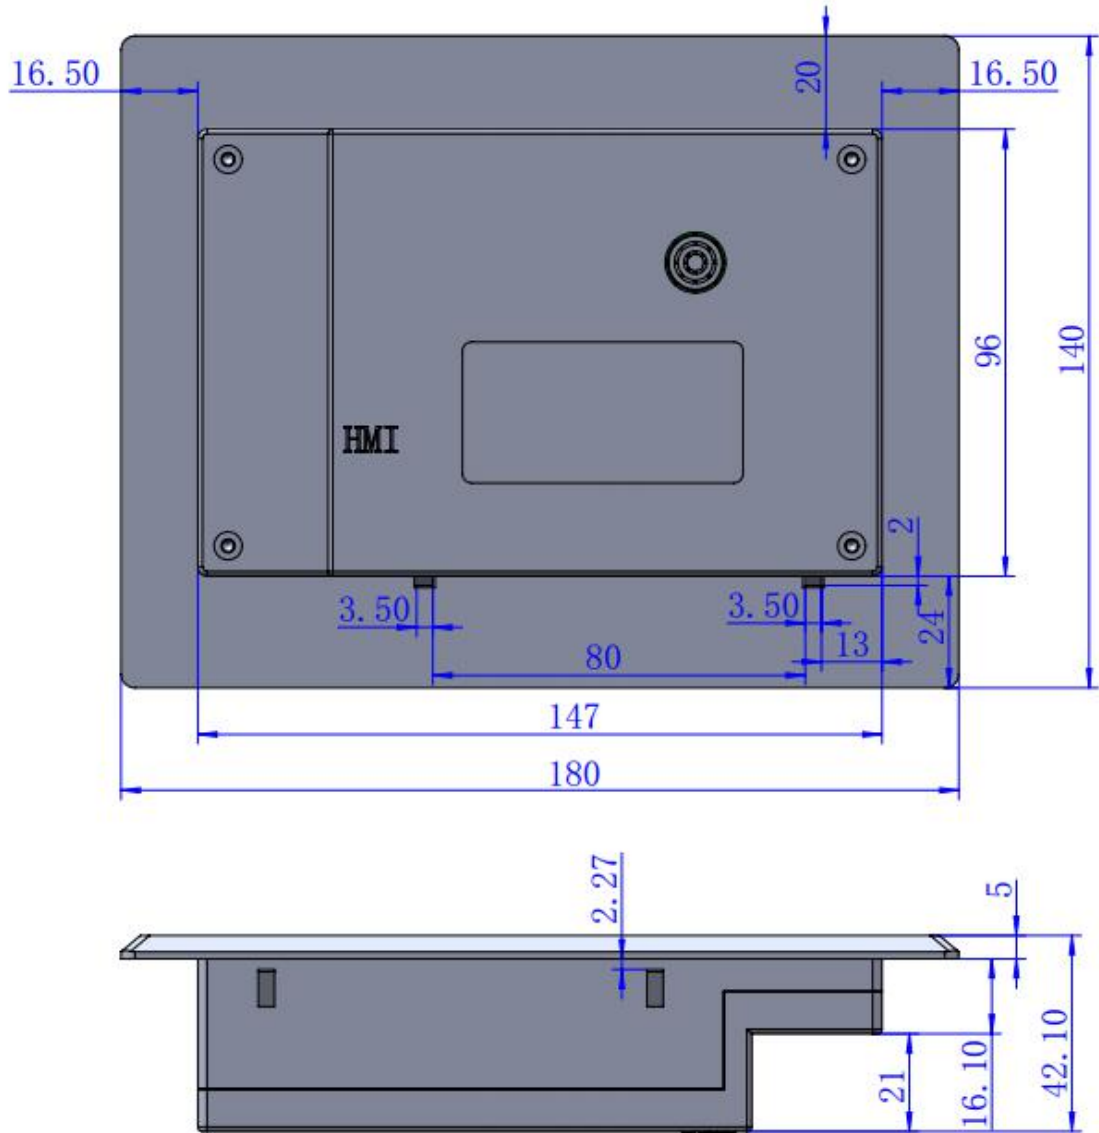


Figure 2.2-1

# Section 3 Object Pictures and Interfaces

## CONTENTS:

- Object Pictures of MainBoard
- Object Pictures of Panel
- Electric connection
- Lamp instruction
- Function distribution of all eight axes

### 3.1 Object Pictures of MainBoard

For more detailed pin description, see the Chapter 4: Description of Interface Signal for MainBoard.

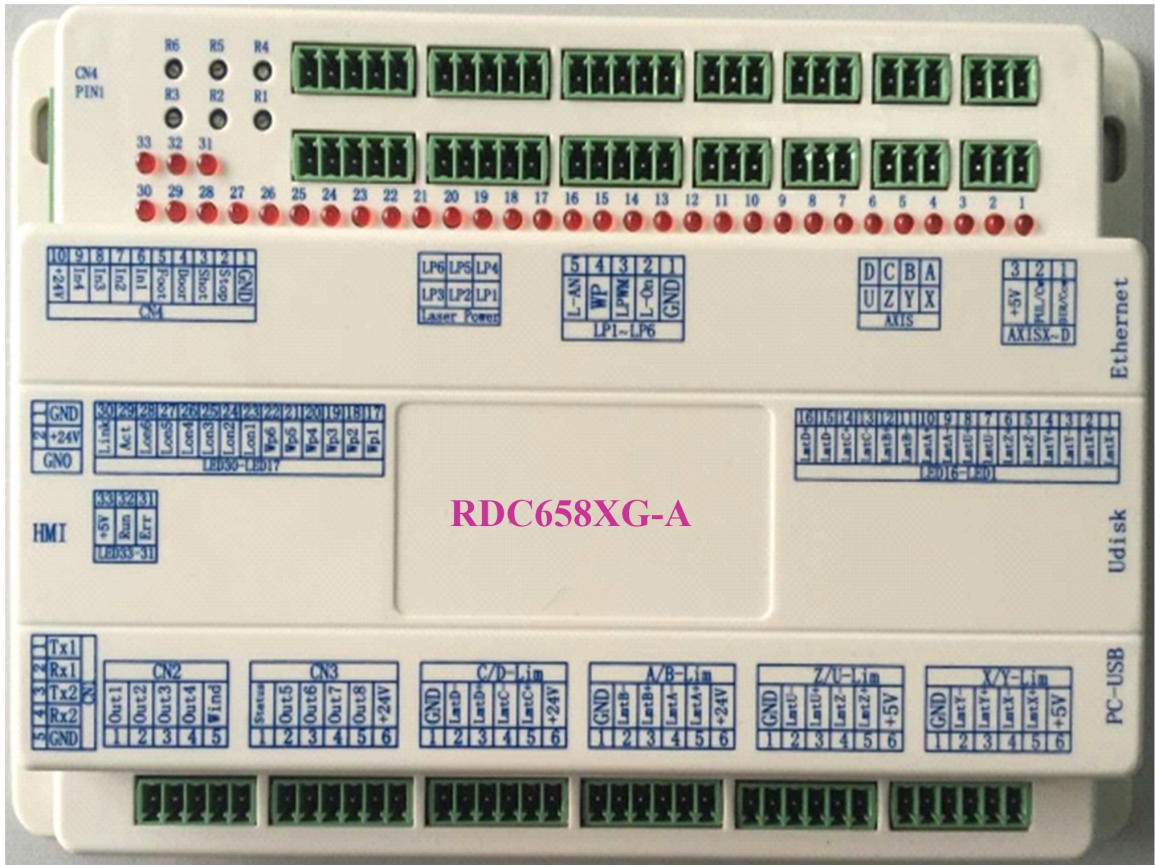


Figure: 3.1-1 Object Picture of MainBoard

### 3.2 Object Pictures of Panel



Figure: 3.2-1 Object Picture of Panel

### 3.3 Electric connection

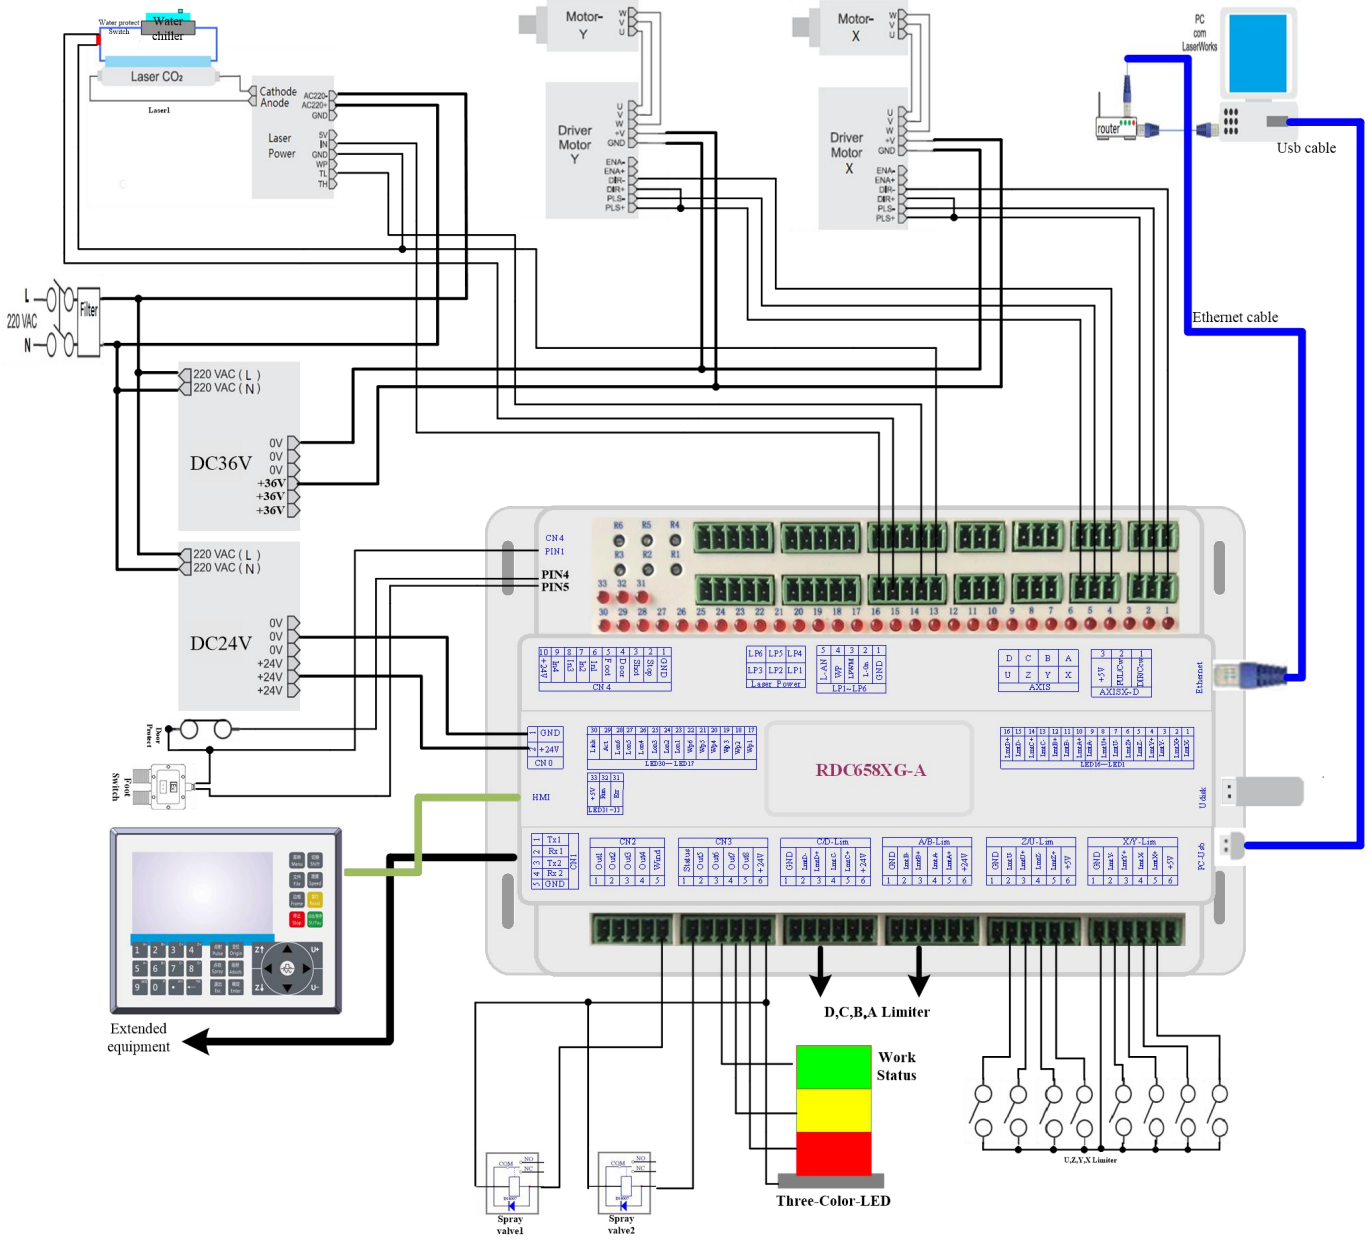


Figure 3.3-1 electric connection

### 3.4 Lamp instruction

RDC6585PC have thirty three red lamps:

LED NUMBER	NAME	SENSE
LED1	LmtX-	X negative limit indicator
LED2	LmtX+	X positive limit
LED3	LmtY-	Y negative limit
LED4	LmtY+	Y positive limit
LED5	LmtZ-	Z negative limit
LED6	LmtZ+	Z positive limit
LED7	LmtU-	U negative limit
LED8	LmtU+	U positive limit
LED9	LmtA-	A negative limit
LED10	LmtA+	A positive limit
LED11	LmtB-	B negative limit
LED12	LmtB+	B positive limit
LED13	LmtC-	C negative limit
LED14	LmtC+	C positive limit
LED15	LmtD-	U negative limit
LED16	LmtD+	U positive limit
LED17	Wp1	the first water protection
LED18	Wp2	the second water protection
LED19	Wp3	Reserved
LED20	Wp4	Reserved
LED21	Wp5	Reserved
LED22	Wp6	Reserved
LED23	Lon1	the first Laser Splash
LED24	Lon2	the second Laser Splash
LED25	Lon3	Reserved
LED26	Lon4	Reserved
LED27	Lon5	Reserved
LED28	Lon6	Reserved
LED29	Act	Ethernet communication
LED30	Link	Ethernet connection
LED31	Err	error in controller hardware
LED32	Run	the normal running status
LED33	+5V	+5V power supply

### 3.5 Function distribution of all eight axes

The function distribution of all eight axes is as below:

	Single Robotized X axes	Double Robotized X axes
X Axes	Used to control the left and right moving or laser header	Used to control the left and right moving or the first laser header
Y Axes	Used to control the up and down moving or laser header	Used to control the up and down moving or laser header
Z Axes	May be mapped to put up and down axes in Layer parameter in PC software	Used to control the left and right moving or the second laser header
U Axes	Used to control feed in Axes	Used to control feed in Axes
A Axes	Up and down control of the first nozzle (in case of motor mode)	Up and down control of the first nozzle (in case of motor mode)
B Axes	May be mapped to put up and down axes in Layer parameter in PC software	Up and down control of the second nozzle (in case of motor mode)
C Axes	Used to Rotating Cut	Used to Rotating Cut
D Axes	Used to Auto-Focus	Used to Auto-Focus

# Section 4 Description of Interface Signal for MainBoard

## CONTENTS:

- Interface of Main  
Power Source CN0
- Panel Signal-Cable  
Interface HMI
- Udisk Interface
- PC-USB Interface
- Ethernet Interface
- Extended Equipment  
Interface CN1



■ Output Port CN2/CN3

■ Input Port CN4


■ 8-axle Spacing Input  
Interface

■ X~D axle Motor Driver  
Interface AXIS\_X~AXIS\_D

■ Laser Power Control  
Interface LP1~LP6

## 4.1 Interface of Main Power Source CN0

Pin	Symbols	Definitions
1	GND	24V power ground (input)
2	+24V	24V power positive (input)

 <b>Caution</b>	This control system employs single 24 power supply. For a certain margin, it is suggested to select 24V/2A power.
---	---

## 4.2 Panel Signal-Cable Interface HMI

The panel signal-cable is a pin-to-pin cable, which is included in the factory shipper bill.

## 4.3 Udisk Interface


Udisk is a USB-AM interface. The controller may visit the u-disk by this interface.

## 4.4 PC-USB Interface

PC-USB is a USB-BM interface. The controller may communicate with PC by this port.

## 4.5 Ethernet Interface

Using this interface, the mainboard can communicate with PC by 10/100MHZ Ethernet.

 <b>Caution</b>	Pin to Pin Ethernet parallel line is recommended.
---	---

## 4.6 Extended Equipment Interface CN1

Pin	Symbols	Definitions
1	TX1	The TX for the first RS232 port
2	RX1	The RX for the first RS232 port
3	TX2	The TX for the second RS232 port
4	RX2	The RX for the second RS232 port
5	GND	Power ground (output)


## 4.7 Output Port CN2/CN3

Definition of output port CN2

引脚	符号	定义
1	Out1	Up and down control of the first nozzle
2	Out2	Up and down control of the second nozzle
3	Out3	Press control
4	Out4	Adsorption control
5	WIND	Switch control of spray valve 1

Definition of output port CN3

Pin	Symbols	Definitions
1	Status	Switch control of spray valve 2
2	Out5	Three-color led logic: buzzer output
3	Out6	Three-color led logic: green led output (work status)
4	Out7	Three-color led logic: yellow led output
5	Out8	Three-color led logic: red led output
6	+24V	24V Power positive output

 <b>Prompt</b>	All outputs are isolated through the optocoupler, and 500mA current for each, OC gate output, each can directly drive the 6V/24V relay.
--	---

## 4.8 Input Port CN4

Pin	Symbols	Definitions
1	GND	Power ground (output)
2	Stop	Stop key input, used to stop the running work
3	Shot	Input for manual laser on/off. Low level is to open laser and high level or no-connection is to close laser.
4	Door	Input from protective port. If the machine needs to be protected in the special state (such as door open protection), the protective signal can be inputted from this pin. This pin can be enabled and prohibited. This signal is not inquired by the mainboard if this pin is prohibited; if this pin is enabled, when the input is high-leveled or this input port is suspended, the machine will be protected, the work suspended and the laser closed.
5	Foot	Input port of foot switch. The connection method is: when the pedal is stepped down, the low-level signal will be inputted to this port; when the pedal is released, the port will be disconnected or the high-level signal can be inputted to this port; when the stepped-down pedal is held for not less than 100 ms, if the machine lies idle, it can be started for work; if the machine is in the working state, the work will be suspended; of the machine is in the suspension, the work will be restarted, that is to say, the function of the pedal switch is the same as that of the "Start/Pause" key. If the interval time to the first stepping-down of the pedal should be less than 100ms when the pedal is stepped down once again, the second stepping-down of the pedal will be considered invalid by the mainboard.
6	IN1	Reserved input
7	IN2	Reserved input
8	IN3	Reserved input
9	IN4	Reserved input
10	+24V	24V Power positive output

## 4.9 8-axle Spacing Input Interface

X/Y axle spacing input X/Y-Lim:

Pin	Symbols	Definitions
1	GND	Power ground (output)
2	LmtY-	The spacing from axle Y- and Y to 0 coordinate
3	LmtY+	The spacing from axle Y+ and Y to max. coordinate
4	LmtX-	The spacing from axle X- and X to 0 coordinate
5	LmtX+	The spacing from axle X+ and X to max. coordinate
6	+5V	5V Power positive (output)

The spacing polarity is optional, that is to say, when the motion axle reaches the spacing position, it will trigger a low-level signal so as to make the corresponding LED (under the cover) light; when the motion axle leaves the spacing position, it will trigger a high-level signal or disconnect the spacing signal so as to make the spacing indicator go out, but when it leaves the spacing, the corresponding indicator will light and the spacing polarity become positive. The mistaken setting of spacing polarity will result that the spacing can't be detected when the system is reset so as to lead to the collision of axles.

The pin definitions of all other axle spacing input such as Z/U-Lim, A/B-Lim and C/D-Lim are the same as X/Y-Lim.

***All X~D axle spacing inputs are compatible to 5V/12V/24V logic level inputs.***

## 4.10 X~D axle Motor Driver Interface AXIS\_X~AXIS\_D


The interfaces of the above four motion axles are the same. The AXIS-X interface is exemplified.

Pin	Symbols	Definitions
1	DIR	Directional signal
2	PUL	Pulse signal
3	+5V	5V Power positive (output)

The polarity of directional signal for driver pulse signal can be set. Where a certain axle is reset, it will move to the opposite direction of machine origin, which means the polarity of directional signal for this axle is not correct. In such a case, the connection between this axle and the motor driver can be broken first (otherwise the mainboard can not be detected to the spacing so as to lead to the collision of this axle), and then such a polarity can be corrected after this axle is reset completely. Upon the correction, the reset key can be pressed against to reset the

mainboard.

And, the Pulse signal can be falling edge valid or rising edge valid. The default setting is falling edge valid.

 <b>Prompt</b>	<p>The Pulse signal and the directional signal are all OC outputs. The Controller must be common anode with the motor driver</p>
--	--

## 4.11 Laser Power Control Interface LP1~LP6

This control system has six independent and adjustable digital laser power control interfaces. LP1 and LP2 are the first / second laser control interfaces respectively, and LP3-LP6 is reserved. The first digital interface (LP1) is hereby exemplified:

Pin	Symbols	Definitions
1	GND	Power ground (output)
2	L-ON1	Laser-enabled control interface 1. When the laser is the RF laser, this pin will not be used; 2. When the laser is a glass tube, if the used laser is outputted in the low-level form, this pin will be connected with the laser power enable end and used to control the ON/Off of laser.
3	LPWM1	Power control interface of laser/laser tube 1. When the laser is the RF laser, this pin will be connected with the laser RF-PWM end; 2. When the laser is a glass tube, this pin will be connected with the laser power PWM end and used to control the power of the laser.
4	WP1	The input port of water protector for the first laser power source. When the water protector 1 is enabled, the mainboard will detect the input port of water protector 1. If this port is of low level, it will be deemed normal; if this port is of high level, the mainboard will forcibly close the laser to suspend the work in progress and the system will warn. If the water protector 1 is not enabled, the mainboard will not detect the input port of water protector 1 and so the water protector 1 can be unconnected. <b><i>Water protection input must be 24V logic level.</i></b>
5	L-AN1	The analog signals for Laser Power. If Glass Tube is used, this pin is recommended to control the power of the Laser.



Prompt

Please correctly select the laser type in the factory parameters.

# Section 5 Examples of Laser Power Interface

## CONTENTS:

- Brief
- Examples of Glass  
Tube Laser Power
- Examples of  
RF-Laser




## 5.1 Brief


This control system has six independent and adjustable digital laser power control interfaces, which can be used to control glass tube laser power and RF-laser. The connection of LPn to laser power is all the same.

*Please correctly select the laser type in the factory parameters, or, the laser control is incorrect.*

## 5.2 Examples of Glass tube Laser Power

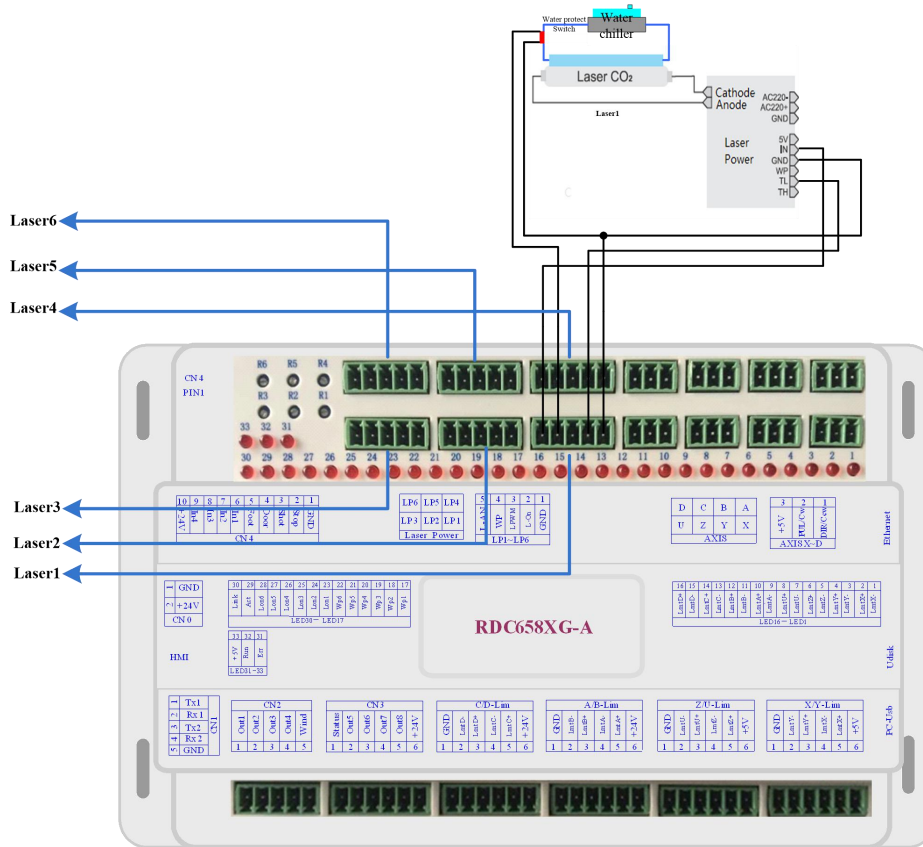

### 5.3 Examples of RF-Laser

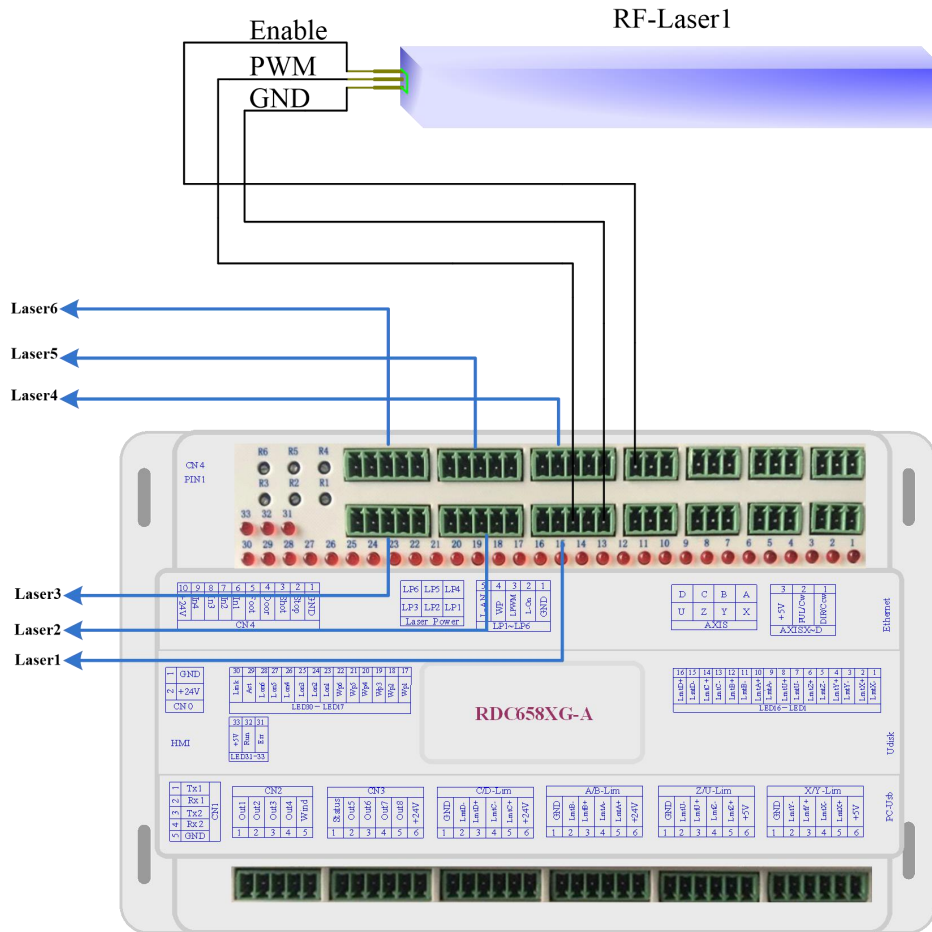

# Section 6 Examples of Driver Interface for Step-servo Motor

## CONTENTS:

- Brief
- Examples of Motor Driver Connection

## 6.1 Brief

The input signal end of step-servo motor driver employs the light-coupled isolation technology. For the step-by-step impulse signal, some isolate the side OC diode from cutoff to conduction (e.g. the valid falling edge of pulse signal inputted from the diode minus end) and some do so from conduction to cutoff (e.g. the valid rising edge of pulse signal inputted from the diode minus end).

***When it is indicated whether the pulse signal of motor driver is the valid rising edge or the valid falling edge, it will be subject to the pulse signal inputted from the minus end of side OC diode.***

Some input signals of motor driver are independent and some are internally of common anode, so some have 4 external leading-out wires and some 3 wires (only the pulse and directional signals are counted) as shown in Figure 6.1-1 and 6.1-2.

RDC6585PC Controller has eight groups of 3-wires motion driver interface, each interface has one direction signal, one pulse signal, and one 5V positive output, the direction signal and the pulse signal are all OC output.

***RDC6585PC controller must be common anode with the motor driver. The polarity of the direction signal can be changed in the factory parameters, and the valid edge of the pulse signal can also be changed.***

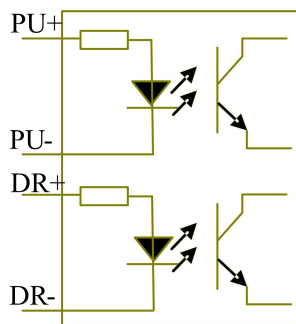


Figure: 6.1-1 Four Inputs, Independent Input Signal of Driver

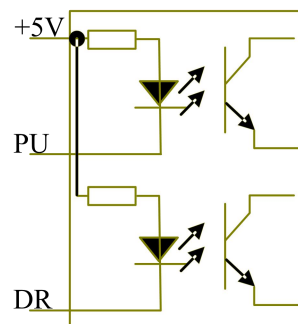


Figure: 6.1-2 Three Inputs, Common-anode Input Signal of Driver

## 6.2 Examples of Motor Driver Connection

The connection between the motor driver and the RDC6585PC controller is given up as chapter 3.3: Electric connection.

# Section 7 Examples of Extended Equipment Interface

## CONTENTS:

- Examples of Extended  
Equipment Interface

## 7.1 Examples of Extended Equipment Interface

The extended communication port, which named RTLink, that is to say CN1, included two ways RS232 ports. The first way can communicate with EPLC400 or wireless handset, which are developed by RuiDa Technology Co.,Ltd. The second way can also communicate with wireless handset or other equipments.

Below is the connection instruction.

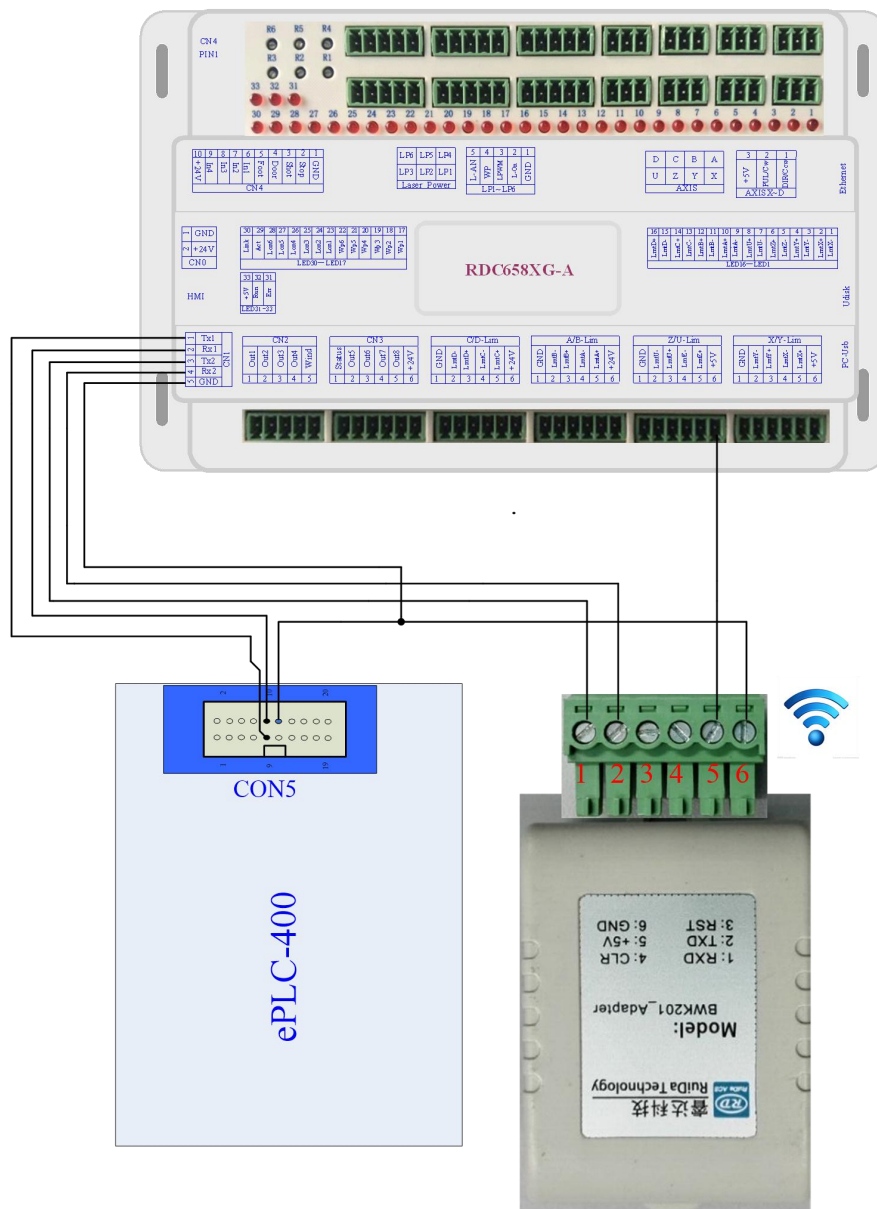


Figure 7.1-1 model1

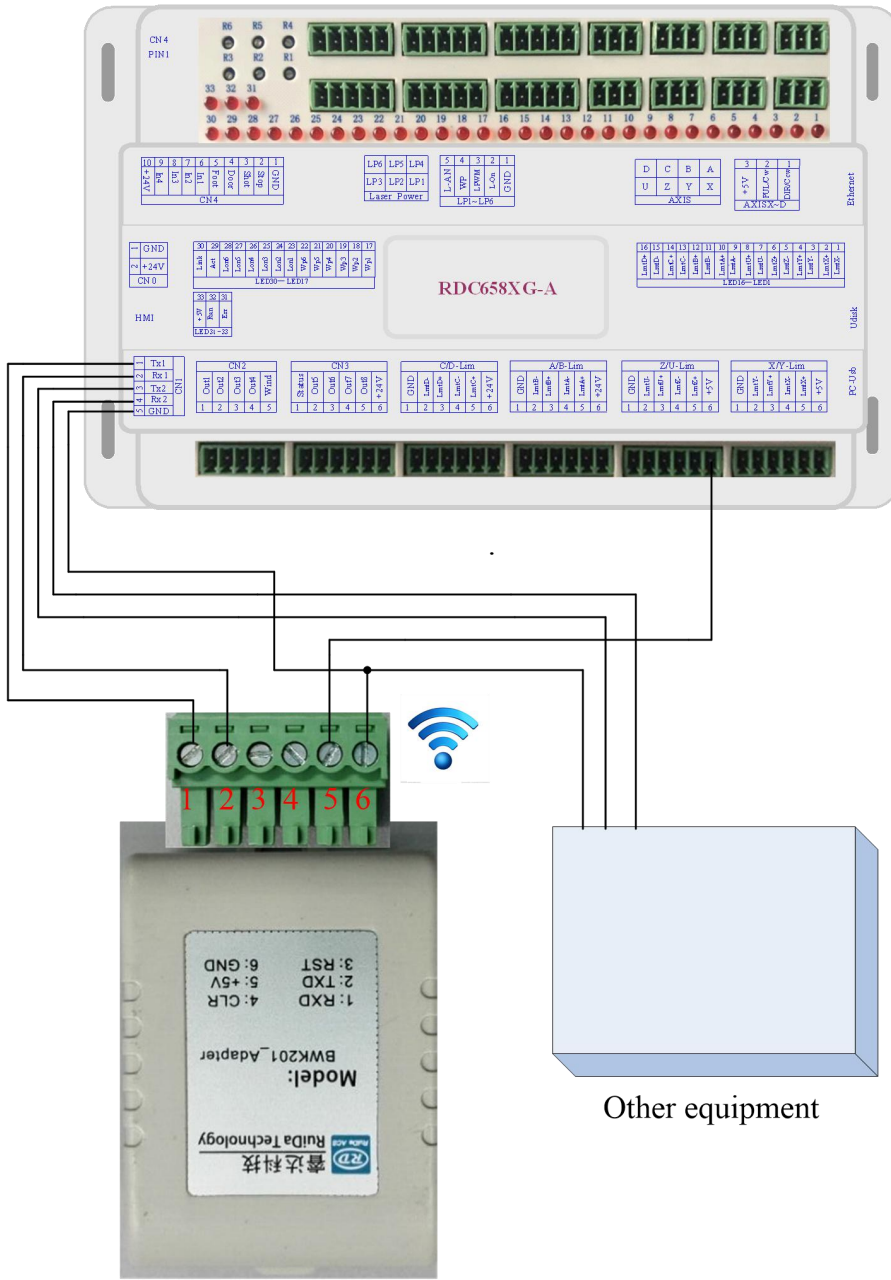


Figure 7.1-2 mode2



# Section 8 Operating Instruction of Panel

## CONTENTS:

- Brief
- Speed Setting Speed Setting
- Max/Min Power Setting
- Set the layer parameters
- Menu Function
- Controller setting
- Funtions
- File Management
- Password input and Settings
- Prompt and alarm Information
- Auto Focus

## 8.1 Brief

### 8.1.1 Overview

RDC6585PC-HMI control panel (hereinafter referred to as "panel") is a 5.0 inch TFT LCD screen based human-machine interface, with beautiful interface, man-machine friendly, smooth control, cost-effective features. The panel can depict the motion track of the controller in real time, which makes the user understand the current processing graphics at a glance, supports file management, file preview, user and manufacturer parameter modification, and supports multi-language interface switching and other functions.

Panel Features:

- 5.0"TFT
- 854×480 resolution
- 64K color
- RS232 standard serial communication

### 8.1.2 Introduction to the Keys





















-  Reset the whole system.
-  To start or pause the work.
-  Let the Laser to splash.
-  Stop working or motor axis motion.
-  Sprinkler point spray glue.
-  User parameters, factory parameters, language settings, etc.


Figure 8.1.1-1 Object picture of

-  **边框**  
Frame To track by the current file's frame.
-  **文件**  
File The management of the memory and U disc files.
-  **定位**  
Origin Set the relative origin.
-  **吸附**  
Adsorb Adsorption interface control button
-  **切换**  
Shift Special function switching.
-  **速度**  
Speed Set the speed of the current running layer, or set the direction keys' move speed.
-  **退出**  
Esc To stop work, or to exit to some menu.
-  **确定**  
Enter Validate the change.
-  To move the X axes and Y axes or Up, down, left and right functions
-  **Z↑ Z↓** Moving Z axis.
-  **U+ U-** Moving U axis.
-  Point movement and continuous motion switching.
-  **.** Decimal point.
-  **←** Backspace.

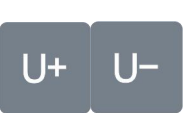

- Digital key 0~9: Used to set parameters. The key with the character in the upper right corner can be combined with the <Shift> key, and pressed to control the A, B, C, D axis, and so on.


### 8.1.3 The main interface

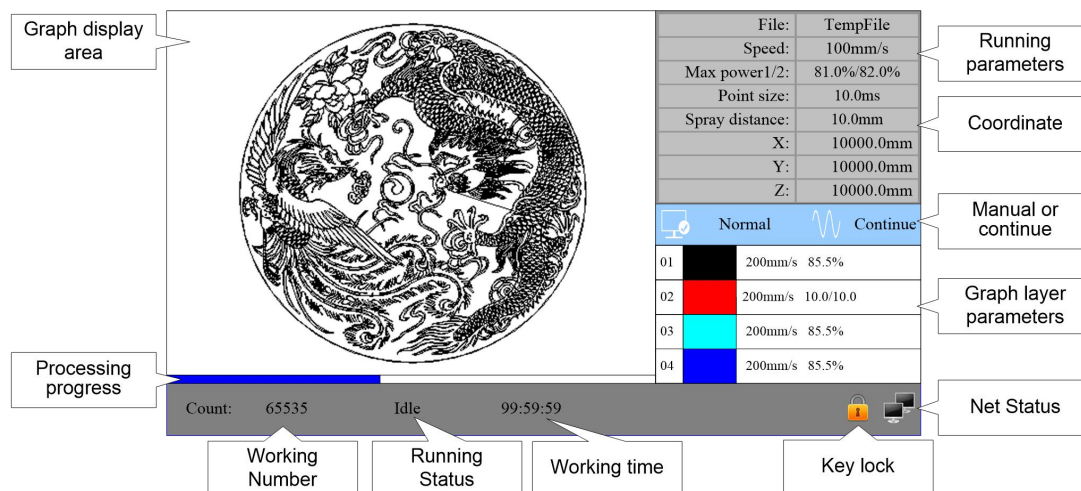When the system is powered on, the screen will show as below:



Figure


- Graph Display Area: To display the whole file's track, and display the running track.
- Running parameters: To display the running file's file number, speed, max power etc..
- Coordinate: To display the current coordinate of X,Y and Z axes.
- Graph layer parameters: To display the layers' information of the current file, such as max or min power, speed etc.. When system is idle, dblclick the layer, then users can change the layer's parameters and the changing would be saved.
  - Running Status: To display the current status of the machine, such as Idle, Run, Pause, Finish, etc..
  - Running Progress Bar: To display the progress bar of the current running file.
  - Working Number: To accumulate the work number of the current file.
  - File Dimension: To display the dimension of the current file.
  - Net status: To display the connecting status of the Ethernet. When the network connection is successful, the icon  is displayed, otherwise the icon  is displayed.

- Key lock status: When the keyboard lock function is enabled, the icon  is displayed, any key press does not respond and prompt for the unlock password, enter the correct unlock password before unlocking.

When work is Idle or finished, all keys can be pushed, users can select a file to run, set some parameters, preview to a select file etc. But, when work is running or paused, some keys don't respond when they are pushed.

## 8.2 Speed Setting

Push the < Speed > key when the screen is on the main interface, it will show as below:

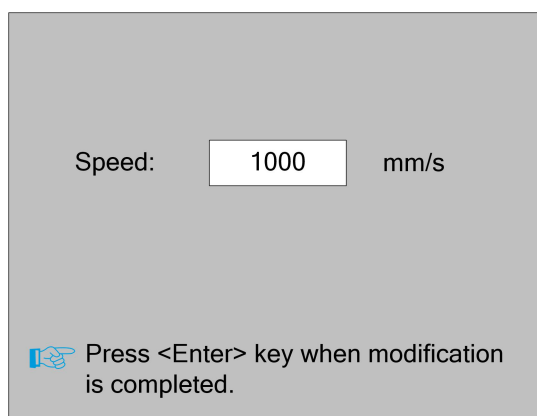

Figure

Press the number key and backspace key to set and modify the parameters. After modifying, press the **<Enter>** key to save the parameters. Press the **<Esc>** key to cancel the modification parameters. The interface disappears and returns to the main interface.

## 8.3 Set the layer parameters

After selecting a file to preview on the main interface, If there is layer information in the layer parameter area, show as below:



 

01		100mm/s 85.5%
02		100mm/s 10.0/10.0
03		100mm/s 85.5%
04		100mm/s 10.0/10.0

Figure 8.3-1

User can push <Enter> key to let the cursor move to the first layer show as below:





01		100mm/s 85.5%
02		100mm/s 10.0/10.0
03		100mm/s 85.5%
04		100mm/s 10.0/10.0

Figure 8.3-2

And then "Up and down" Keys can be pushed to select the intent layer, on that time, user can push <Enter> key to check the selected layer's parameters, When the processing mode of the selected layer number is laser cutting, show as below:

Work Mode:

Layer0: 

Speed(mm/s):  mm/s

Power1(%):  (Min)  (Max)

Power2(%):  (Min)  (Max)



 按<确定>键修改  
按<退出>键返回上级菜单

Figure 8.3-3

When the processing mode of the selected layer number is glued, show as below:

Work Mode:

Layer0: 

Speed(mm/s):  mm/s

Point Size:  ms

Spray distance:  mm



 按<确定>键修改  
按<退出>键返回上级菜单

Figure 8.3-4

At this point, the "blue selection block" stays on the layer number entry, and then press the <Enter> key to enter the selection layer mode, while the "blue selection block" becomes  , press

the "up/down" key to select other layers, and then press the <Enter> key to exit the layer selection mode. Then press the "up/down" key to move the "selection block" to the layer parameter entry to be modified. Press the number key and the backspace key to set and modify the parameters. After setting the parameters, move the "selection block" to the "write parameters" entry. Press the <Enter> key to save the current layer parameters, otherwise the parameters will not be saved. Press the <Esc> key interface to disappear and return to the main interface.

## 8.4 Menu Function

Push the < Menu> key when the screen is on the main interface, it will show as below:

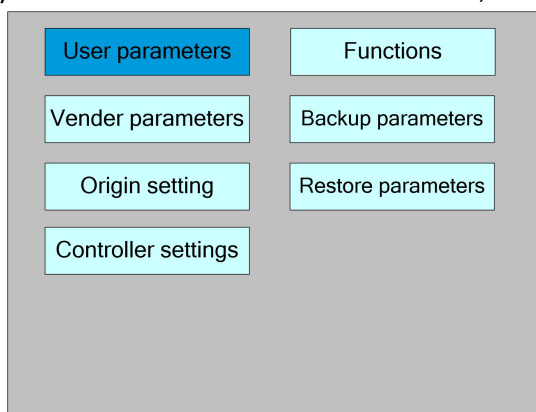


Figure 8.5

Press the <Esc> key to return to the previous menu.

### 8.4.1 Focusing

In the menu interface, select "Focusing" entry and press the <Enter> key ,  
Automatically find focus.

### 8.4.2 Max/Min Power Setting

In the menu interface, select "Power" entry and press the <Enter> key ,it will show as below:

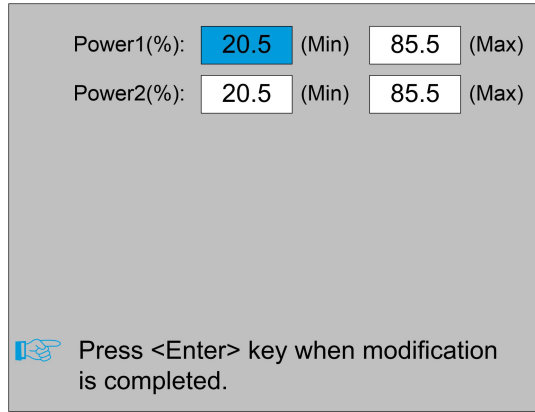


Figure 8.4.2

At this point, the "blue selection block" stays on the first parameter to indicate that the parameter is selected, press the number key and the backspace key to set and modify the parameter. Press the arrow button to move the "select block" to select other parameters for modification. When the parameters are modified, press the <Enter> key to save the parameters, press the <Esc> key to cancel the parameters, the interface disappears and returns to the main interface.

### 8.4.3 User parameters

In the menu interface, select "User parameters" entry and press the <Enter> key ,it will show as below:

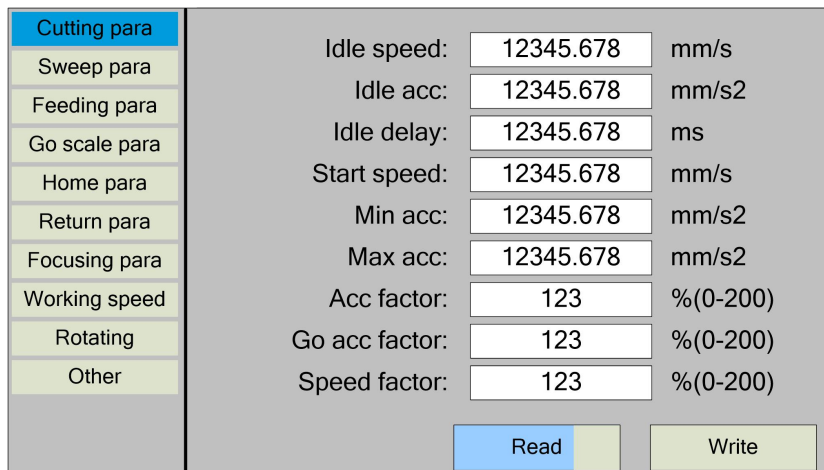


Figure 8.4.3-1

At this point, the panel automatically reads the motherboard parameters and displays them, while displaying the progress of the read parameters in the "Read Parameters" entry. When all the parameters are read out, the user can press the "up/down" key to move the "blue selection block" to select a parameter category such as "carving", "feeding" and so on. The right parameter area displays



the corresponding parameters. If the user does not need to modify the parameters, press the <Esc> key to return to the menu interface.

If the user needs to modify the parameters, press the <Enter> button, and the "blue selection block" switches to the first parameter in the parameter area, as shown in the following interface:

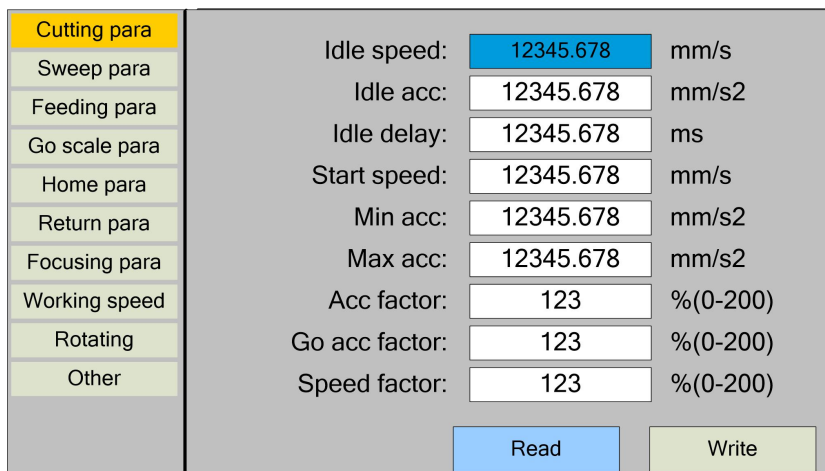



Figure 8.4.3-2

At this point, the user can press the "up/down" key to select a parameter, press the number key to modify the numerical parameters (such as "Idle speed"), for non-numerical parameters (such as "Scan mode"), when the "blue selection block" stops on the parameter, press the <Enter> key to enter the modification mode (the "blue selection block" right side becomes ), press the "up/down" key. Modify the parameters. After the modification, press the <Enter> key to exit the modification mode. When the current page parameters have been modified, move the "blue selection block" to the "Write" entry and press the <Enter> key. The panel saves all the parameters on the motherboard and takes effect, and displays the save progress on the "Write" entry. If the user wants to verify that the parameters are saved successfully, he can move the "blue selection block" to the "Read" entry and press the <Enter> key, then the panel reads the motherboard parameters again and displays them. When pressing the "left/right" key, the Blue Select Block switches back to the parameter category, as shown in Figure 8.5.1-1, where the user can select another parameter category to modify or press <Esc> to return to the menu interface.

Other interface operations are similar, and the interface is displayed as follows:

Cutting para	
Sweep para	X start speed: 12345.678 mm/s
Feeding para	Y start speed: 12345.678 mm/s
Go scale para	X Acc: 12345.678 mm/s <sup>2</sup>
Home para	Y Acc: 12345.678 mm/s <sup>2</sup>
Return para	Line shift speed: 12345.678 mm/s
Focusing para	Scan mode: Normal
Working speed	Facula size: 00.0 %
Rotating	Engraving factor: 100 (0-100)%
Other	
Read Write	

Cutting para	
Sweep para	Delay before feed: 12345.678 s
Feeding para	Delay after feed: 12345 ms
Go scale para	Progressive feeding: No
Home para	Progressive feeding comp: 12345.678 mm
Return para	Last feeding: Yes
Focusing para	
Working speed	
Rotating	
Other	
Read Write	

Cutting para	
Sweep para	
Feeding para	
Go scale para	Go scale mode: Close laser
Home para	Go scale blank: 12345.678 mm
Return para	
Focusing para	
Working speed	
Rotating	
Other	
Read Write	


Cutting para	
Sweep para	XY home speed: 12345.678 mm/s
Feeding para	Z home speed: 12345.678 mm/s
Go scale para	U home speed: 12345.678 mm/s
Home para	A home speed: 12345.678 mm/s
Return para	B home speed: 12345.678 mm/s
Focusing para	C home speed: 12345.678 mm/s
Working speed	D home speed: 12345.678 mm/s
Rotating	
Other	
<< 1/2 >> Read Write	

Cutting para	
Sweep para	Auto home X: Yes
Feeding para	Auto home Y: Yes
Go scale para	Auto home Z: Yes
Home para	Auto home U: Yes
Return para	Auto home A: Yes
Focusing para	Auto home B: Yes
Working speed	Auto home C: Yes
Rotating	Auto home D: Yes
Other	
<< 2/2 >> Read Write	

Cutting para	
Sweep para	
Feeding para	
Go scale para	Return position: Origin
Home para	Docking point X: 12345.678 mm
Return para	Docking point Y: 12345.678 mm
Focusing para	
Working speed	
Rotating	
Other	
Read Write	

Cutting para	
Sweep para	
Feeding para	
Go scale para	Focus depth: 12345.678 mm
Home para	Material thickness: 12345.678 mm
Return para	Enable focus: No
Focusing para	
Working speed	
Rotating	
Other	
Read Write	

Cutting para	
Sweep para	
Feeding para	
Go scale para	
Home para	Z work speed: 12345.678 mm/s
Return para	U work speed: 12345.678 mm/s
Focusing para	
Working speed	
Rotating	
Other	
Read Write	

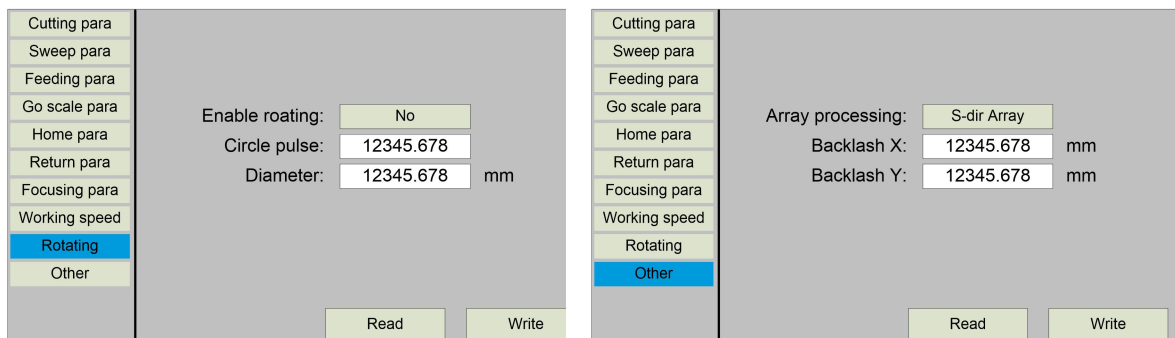

### 8.4.4 Vender parameters

In the menu interface, select "Vender parameters" entry and press the <Enter> key ,it will show as below:

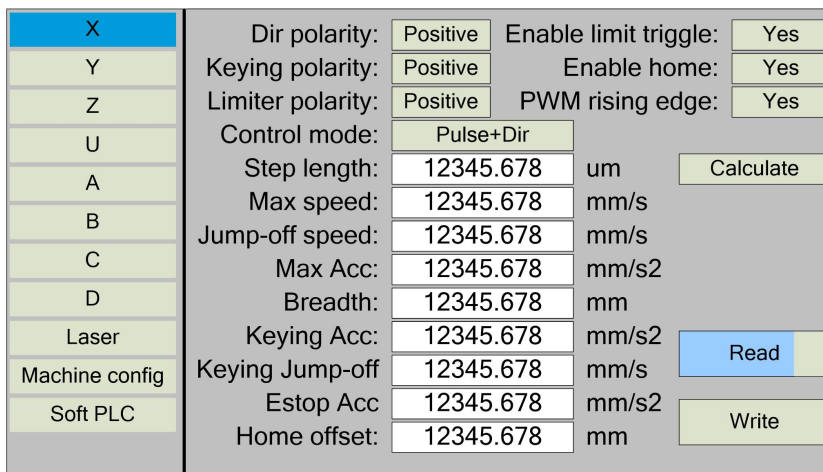


Figure 8.4.4-1

The interface parameters of Y,Z,U,A,B,C and D axes are the same as those of X axis parameters.

X	Laser config:	One tube
Y	Laser attenuation:	0.0 %
Z	Laser:	1
U	Laser mode:	Glass tube
A	Laser enable:	Yes
B	Min power:	00.0 %
C	Max power:	00.0 %
D	Laser freq:	12345.678 KHZ
Laser	Enable standby	Yes
Machine config	Preginition freq:	12345.678 KHZ
Soft PLC	Preginition pulse:	00.0 %
	Signal level:	Low
		Read Write

X	Machine type:	General
Y	Feed mode:	Single
Z	Broken delay:	12345 ms
U	Trans mode:	Belt-motor
A	Z function:	Platform
B	Water protect 1:	No
C	Water protect 2:	Yes
D	Water protect 3:	Yes
Laser	Water protect 4:	Yes
Machine config	Water protect 5:	Yes
Soft PLC	Water protect 6:	Yes
	<< 1/3 >>	Read Write

X	Enable blower:	Yes
Y	Enable protect:	Yes
Z	Press control:	Yes
U	HOME Y:	above
A	Y double drive:	Yes
B	Mirror cutting:	No
C	Head num:	1
D	Drive type:	Single belt
Laser	Head dis1:	12345.678 mm
Machine config	Head dis2:	12345.678 mm
Soft PLC	Head dis3:	12345.678 mm
	<< 2/3 >>	Read Write

X	Head dis4:	12345.678 mm
Y	Head dis5:	12345.678 mm
Z		
U		
A		
B		
C		
D		
Laser		
Machine config		
Soft PLC		
	<< 3/3 >>	Read Write

X	Enable lamp:	Yes
Y	Enable bell:	No
Z		
U		
A	Green lamp:	Idle Run Paus Alarm
B	Yellow lamp:	Idle Run Paus Alarm
C	Red lamp:	Idle Run Paus Alarm
D	Bell:	Idle Run Paus Alarm
Laser		
Machine config		
Soft PLC		
		Read Write

The operation and settings of the factory parameters are the same as the user parameters.

### 8.4.5 Origin Setting

In the menu interface, select "Origin setting" entry and press the <Enter> key ,it will show as below:

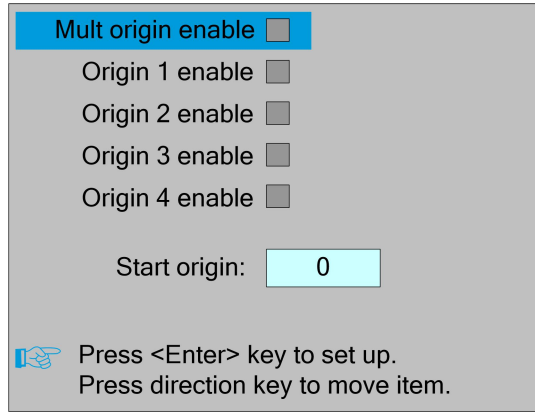


Figure 8.4.5-1

At this point, the "blue selection block" defaults to select the "Mult origin enable" entry, press the **<Enter>** key to enable or disable (the right small square shows red when enabled), when enabled, the little finger to "Origin 1 enable" entry means to start setting the origin point 1, first move the "blue selection block" to this entry and press the **<Enter>** key to enable the location point 1 entry, then press **<Shift>** key, then press the direction key to change the X/Y axis coordinate value, then press **<Origin>** key to set the current coordinate value to the location point 1, and finally press **<Shift>** key to return to the current interface operation. The operation process interface is as follows:

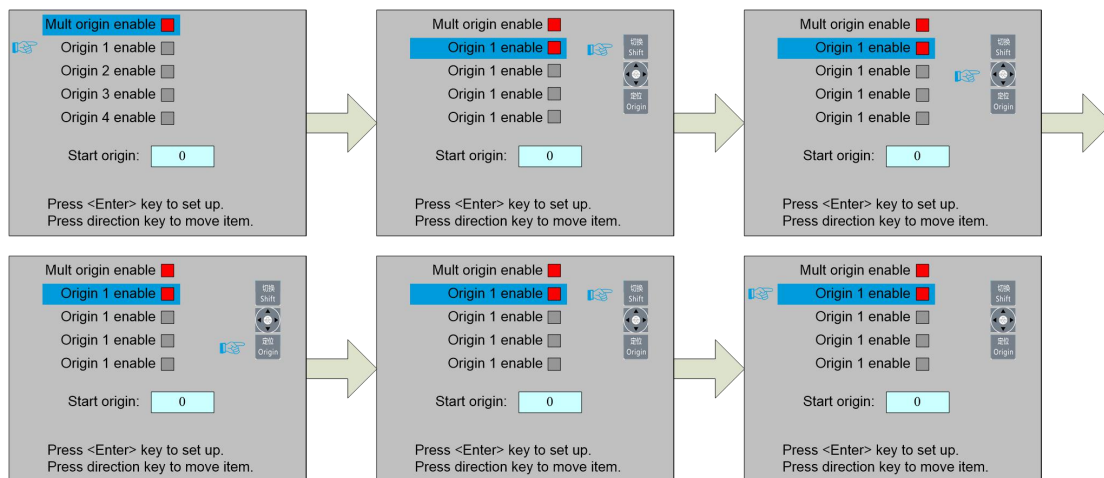



Figure 8.4.5-2

Other origins are set in the same way.

When the "Select Block" stops on the "Start origin" entry, press the **<Enter>** key to enter the modification, press the "Up/Down" key to modify, after the modification, press the **<Enter>** key, the parameters automatically take effect, and press the **<Esc>** key to return to the menu interface.


Each item introduced as below:

- **Multiple Origins Enable:** “Yes” or “No” can be selected. If you select “No”, the system will use the single-origin logic. You can press the **<Origin>** key and set the origin, and only this origin can become valid. If you select “Yes”, the system will use the multiple- origin logic and the **<Origin>** key on the keyboard become invalid. In such a case, the parameter of each origin must be set in the menu as follows.
- **Origin Enable1/2/3/4:** after the multiple-origin logic is enabled, the four origins can independently be prohibited and enabled.
- **Start Origin:** there are such five digits as 0~4 for option, which are the origins to be used for the next figure. Origin 0 means the origin set by the **<Origin>** key on the panel in the single- origin logic. 1~4 means the serial number of the origins in the multiple- origin logic. Start origin can be modified to any one of origin 1~4, so as to control the start location of next work (the premise is that the origin is enabled), but it can't be modified to origin 0.

 <b>Prompt</b>	<p>Once the multiple- origin logic is selected and if the serial number of the next origin is 1 and four origins are enabled, when the memory file function is started or the processing file is uploaded into the PC and this file selects “Take the Original Origin as current Origin”, the work started for each time will use different origins. The rotation order of origin is 1-&gt;2-&gt;3-&gt;4-&gt;1-&gt;2.....</p>
--	---

## 8.4.6 Backup parameters

In the menu interface, select the "Backup Factory Parameters" entry, press the **<Enter>** button and then pop up the password input interface. The password input operation refers to Section 8.9. If the password is input correctly, the system will backup all the current user parameters and factory parameters. Interface prompt "Backup parameter is successful".

 <b>Prompt</b>	<p>After the manufacturer regulates all parameters of the machine well (including all manufacturer parameters and user parameters), this function can be used to store the well-regulated parameters to help users to recover the original parameters (including all manufacturer parameters and user parameters) through selecting “Recover Para” when they regulate parameters improperly.</p>
--	--

## 8.4.7 Restore parameters

In the menu interface, select the "Restore Factory Parameters" entry, press the **<Enter>** button and then pop up the password input interface. The password input operation refers to Section 8.9. If the password is input correctly, the system will restore all the current user parameters and factory parameters with the factory parameters set before. Interface prompt "recovery parameter is successful".

## 8.5 Controller setting

Select the "Controller Settings" entry under the menu interface, press the **<Enter>** button, and then pop up the controller settings interface as follows:

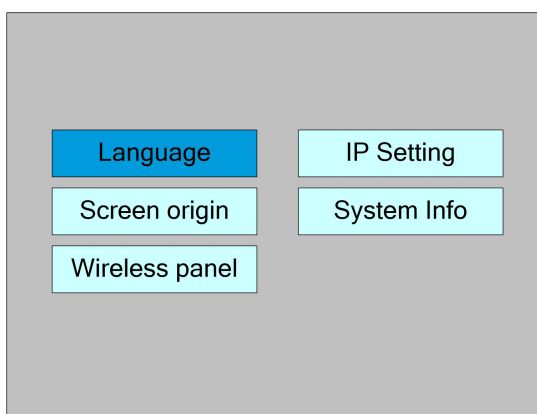


Figure 8.5

Press the **<Esc>** key to return to the previous menu.

### 8.5.1 Language

Select the "Language" entry under the controller setting interface, press the **<Enter>** button, and then pop up the language settings interface as follows:



Figure

Press the direction key to select a language and press the **<Enter>** key to set up the function and automatically return to the menu interface.

### 8.5.2 Screen origin

Select the "Screen origin" entry under the controller setting interface, press the **<Enter>** button, and then pop up the interface as follows:

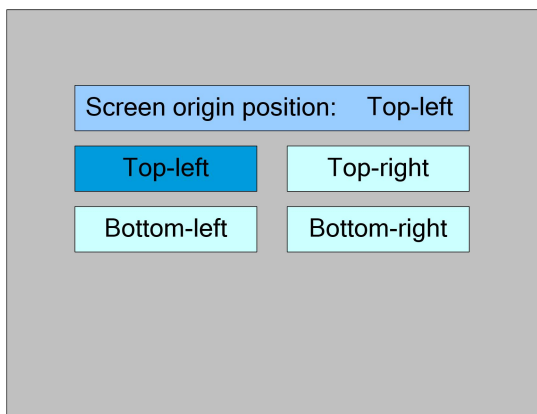



Figure 8.5.2

The display screen's origin position is set here, and different screen origin positions are selected to adjust the display graphics position in different X or Y directions.


Press the direction key to select a item and press the **<Enter>** key to set up the position and press the **<Esc>** key return to the main interface.

 <b>Caution</b>	This item is only used to preview the file on the screen, and it is no meaning to the machine's movement.
---	---




### 8.5.3 Wireless panel

Select the "Wireless panel" entry under the controller setting interface, press the **<Enter>** button, and then pop up the interface as follows:

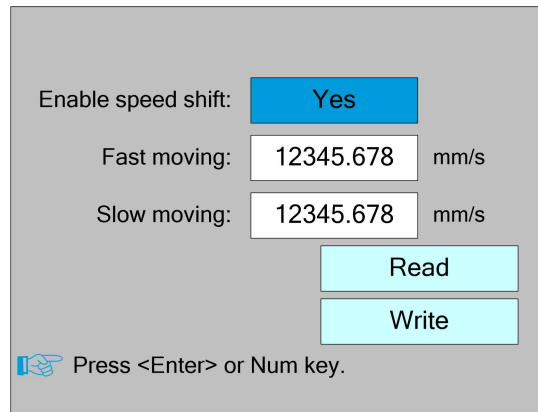

Figure

When modifying the first parameter, press the **<Enter>** key to enter the modification mode ("blue selection block" right side becomes ) , press the "Up/Down" key to modify, and then press the **<Enter>** key to exit the modification mode. Press the direction key to select other parameters and press the number key to modify the parameters. After the modification, move the "selection block" to the "Write " entry and press the **<Enter>** key. The parameter setting takes effect. Press the **<Esc>** key to return to the previous menu.

### 8.5.4 IP Setting

Select the "IP setting" entry under the controller setting interface, press the **<Enter>** button, and then pop up the interface as follows:

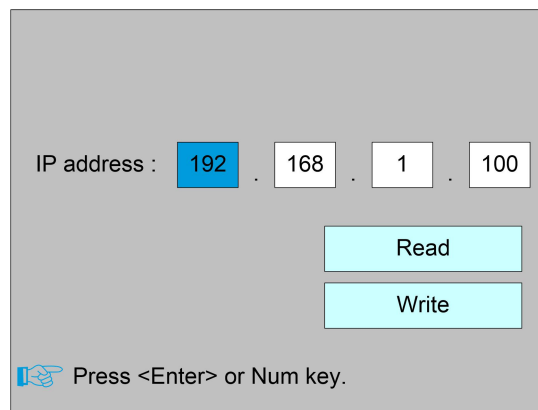


Figure 8.5.4

Press the direction key to select a parameter, then press the number key to modify the parameter. After the modification, move the "selection block" to the "Write" entry and press the <Enter> key. The parameter setting takes effect. Press the <Esc> key to return to the menu at the previous menu.

### 8.5.5 System Info

Select the "System Info" entry under the controller setting interface, press the <Enter> button, and then pop up the interface as follows:

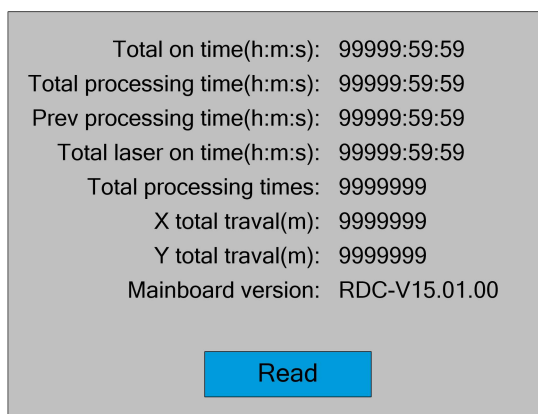


Figure 8.5.5

Press the <Enter> key to read motherboard information. Press the <Esc> key to return to the previous menu.

### 8.6 Funtions

In the menu interface, select "Function" entry and press the <Enter> key ,it will show as below:


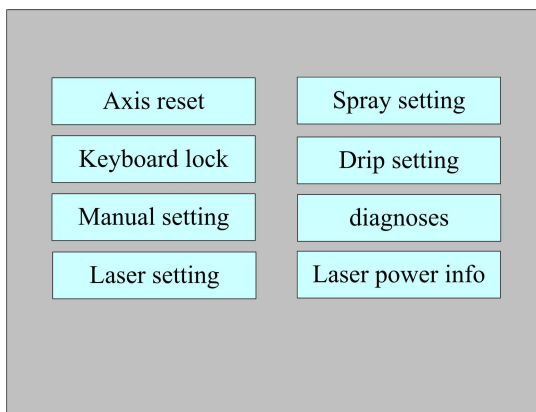


Figure 8.6

Press the <Esc> key to return to the previous menu.

### 8.6.1 Axis reset

Select the "Axis reset" entry under the controller setting interface, press the <Enter> button, and then pop up the interface as follows:

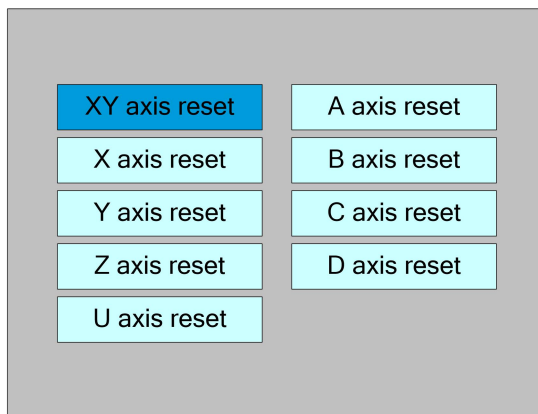

6Figure 8.7.1

Press the direction key to select an entry and press the <Enter> key, the system performs the axis reset, and prompts "Resetting...".

Press the <Esc> key to return to the previous menu.

### 8.6.2 Keyboard lock

Select the "Keyboard lock" entry under the controller setting interface, press the <Enter> button, and then pop up the interface as follows:

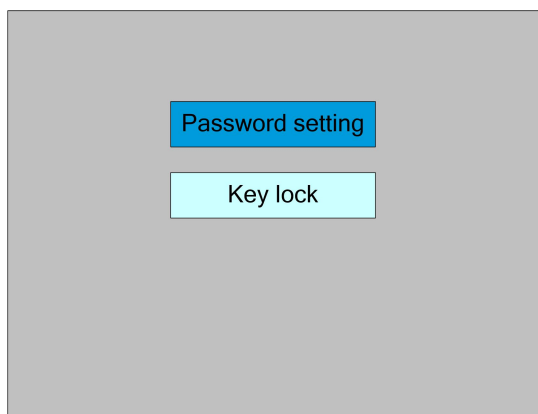


Figure 8.6.2

- Password setting

This entry allows you to set the default password for keyboard locking and use the new

password for keyboard locking after setting up successfully.

- Key lock

This item can lock the keys. After entering the correct password, the keys automatically lock and return to the main interface. When any key is pressed, the interface prompts the input password to unlock the keys.

Please refer to section 8.9 for password input and password settings. Press the **<Esc>** key to return to the previous menu.

### 8.6.3 Manual setting

Select the "Manual setting" entry under the functions interface, press the **<Enter>** button, and then pop up the interface as follows:

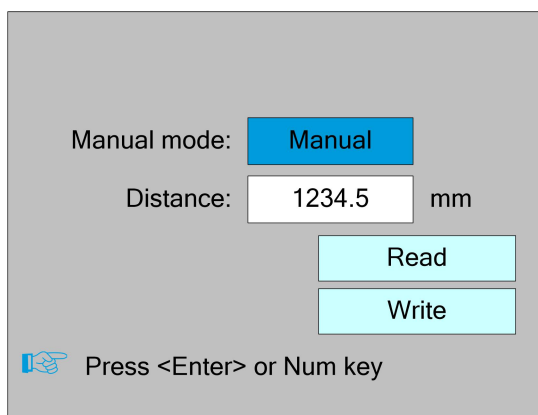



Figure 8.6.3

Manual mode has "Continue" and "Manual", press the **<Enter>** key to enter the modification mode ("blue selection block" right side becomes ), press the "up/down" key to modify, after the modification, press the **<Enter>** key to exit the modification mode. After all modifications, move the "Select block" to the Write Parameters entry and press the **<Enter>** key. The parameter settings take effect. Press **<Esc>** key to return to the previous menu.

When "Continue" item is selected, then the "Manual" item is not valid, on that time, push the direction keys to move the corresponding axes, and when the pushed key is loosed, then the corresponding axes will finish moving. When the Mode item is "manual", then pushing the direction key one time, the corresponding axes will move a fixed length, unless the scope is overstepped.

### 8.6.4 Laser Setting

Select the "Laser setting" entry under the functions interface, press the **<Enter>** button, and then pop up the interface as follows:

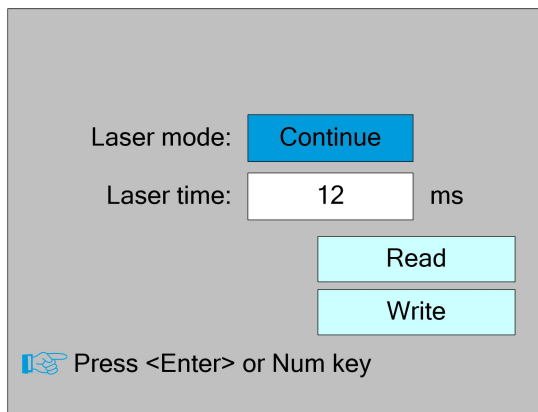


Figure 8.6.4

The operation method is the same as manual setting.

When “Continue” item is selected, then the “Laser time” item is not valid, on that time, push the Laser key to splash the enabled lasers, and when Laser key is loosed, then the lasers will finish splashing. When the Laser mode item is “Manual”, then pushing the Laser key one time, the enabled lasers will splash a fixed time.

## 8.6.5 Spray setting

Select the "spray setting" entry under the funtions interface, press the **<Enter>** key, and then pop up the interface as follows:

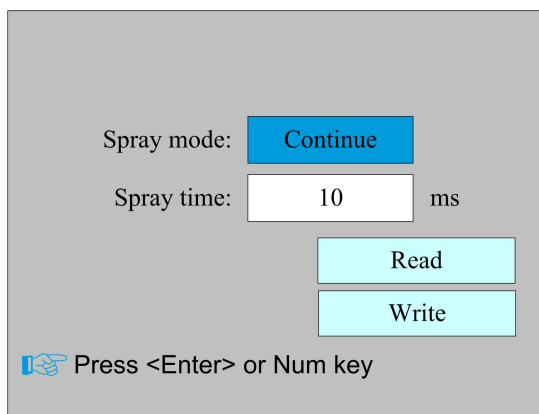


Figure 8.6.5

When “Continue” item is selected, then the “Spray time” item is not valid, on that time, push the Spray key to splash the enabled spray, and when Spray key is loosed, then the spray will finish splashing. When the Laser mode item is “Manual”, then pushing the Laser key one time, the enabled spray will glue a fixed time.

### 8.6.6 Drip setting

Select the "drop setting" entry under the funtions interface, press the <Enter> key, and then pop up the interface as follows:

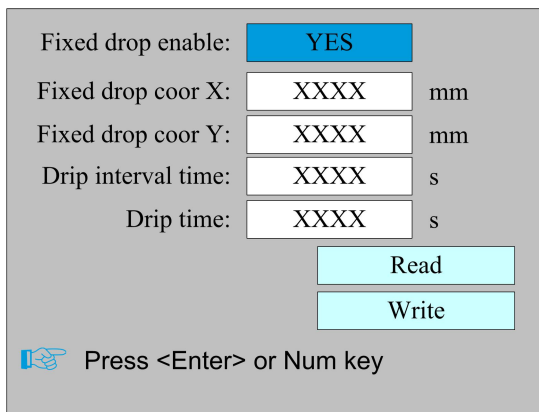


Figure 8.6.6

There are two options for the fixed drop enable. Press the [OK] key to enter the modify mode (the right side of the "blue selection block" becomes), press the "up/down" key to modify, press the [OK] key after the modification is completed. Exit the modification mode. After all the modifications are completed, move the "Select Block" to the "Write Parameter" item and press the [OK] key. The parameter setting takes effect. Press the [Exit] key to return to the previous menu.

When "Yes" is selected, the fixed drop function is enabled, and the fixed drop function can be used normally; when "No" is selected, the fixed drop function is invalid. The fixed drop position of the fixed drop function can be set by "fixed drop coordinate X" and "fixed drop coordinate Y". The "drip interval time" is the interval time of each fixed drop, and the "fixed drip time" is the time for the glue to be dispensed each time.

### 8.6.7 Diagnose

Select the "Diagnose" entry under the funtions interface, press the <Enter> key, and then pop up the interface as follows:

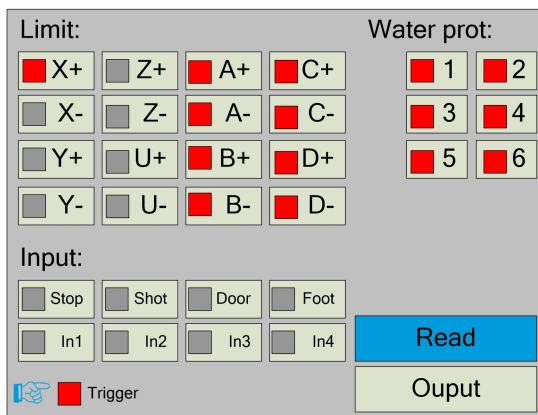


Figure 8.6.7-1

This interface displays the system's limit input status, water protection input status, and general input port status., and reads the hardware information of the system by pressing the **<Enter>** key. When the hardware signal is triggered, the small box on the left side of the corresponding entry will show red. Otherwise, it will show gray. Press the **<Esc>** key to return to the previous menu.

When selecting the "Output" item, press the **<Enter>** key, the following interface pops up:

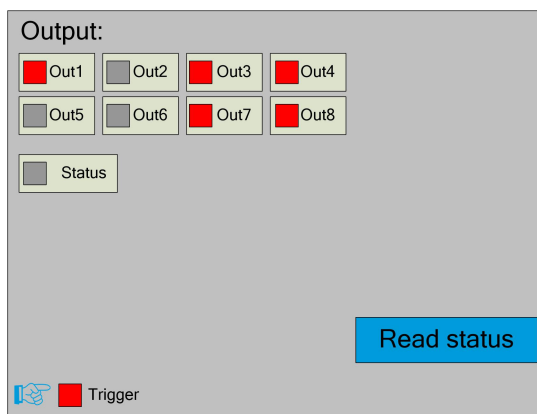


图 8.6.7-2

When the "blue selection block" stops on the "Read status" item, press the **<Enter>** key to refresh the status of each output port. Press the direction key to move the "blue selection block" to any output port and press the **<Enter>** key. Switch the corresponding output port status to trigger or disable. Press the **<Esc>** key to return to the previous menu.

## 8.6.8 Laser power information

Note: laser power information function is effectively configured on PC software.

Select the "Laser power info" entry under the functions interface, press the **<Enter>** button, and then pop up the interface as follows:

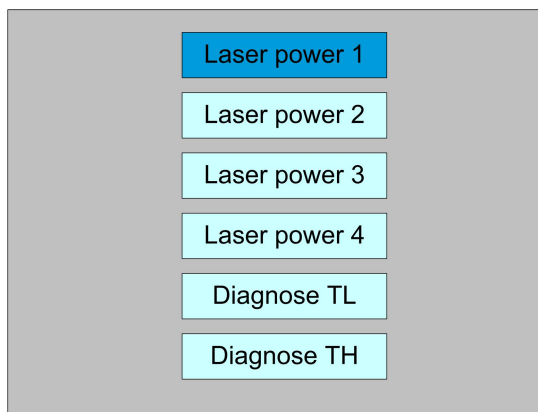


Figure 8.6.8-1

When the "blue selection block" stops at the items 1, 2, 3 and 4 of the laser power supply, press the <Enter> key to view the information of each power supply. The interface is as follows:

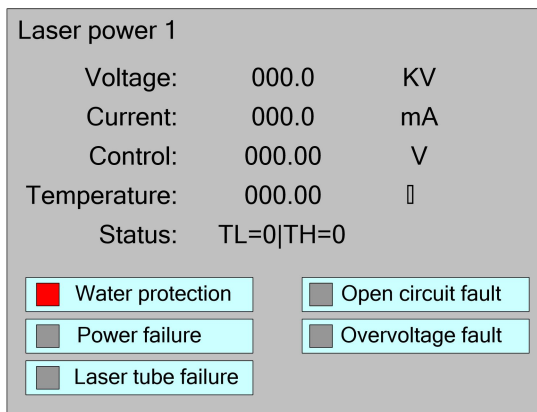


Figure 8.6.8-2

When the "blue selection block" stops at the "diagnostic TL" and "diagnostic TH" entries, press the <Enter> key to check whether the IO of the laser power supply is abnormal, and if so, an alarm will be generated.

Press the <Esc> key to return to the previous menu.

## 8.7 File Management

### 8.7.1 Memory File

Push the <Menu> key when the screen is on the main interface, it will show as below:

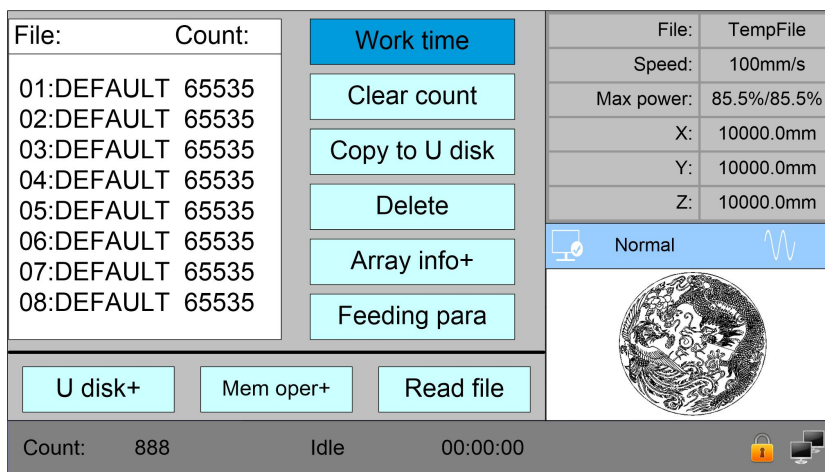


Figure 8.7.1



When showing this menu, the system would read the memory file firstly, the file name and the work times would be listed in the area, and the selected file is previewed in the bottom right area. <Up >/<Down> keys could be used to move the cursor on the file name list. When the cursor is on a target file name, presses the <Enter> key, the selected file will be previewed on the main interface, and then if <Esc> key is pushed, the preview will disappear.

<Left>/<Right> keys could be used to move the cursor left and right.

Press the <Esc> key to return to the previous menu.

The items on the right and bottom are as follows:

- **Run:** To run the selected file;
- **Track:** To track the selected file, and the track mode is optional;
- **Work time:** To forecast the running time of the selected file, and the time is accurate to 1ms;
- **Clear count:** To clear the running times of the selected file;
- **Copy to U disk:** To copy the selected file to U disk;
- **Delete:** To delete the selected file in the memory;
- **U disk:** read the U disk file list;
- **Memery operation:** the other operation of the memory files;
- **Read mem file:** read the memory file list;

## 8.7.2 Array info

Select the "Array info" entry in the above interface and press the <Enter> button, then the pop-up menu appears as follows:

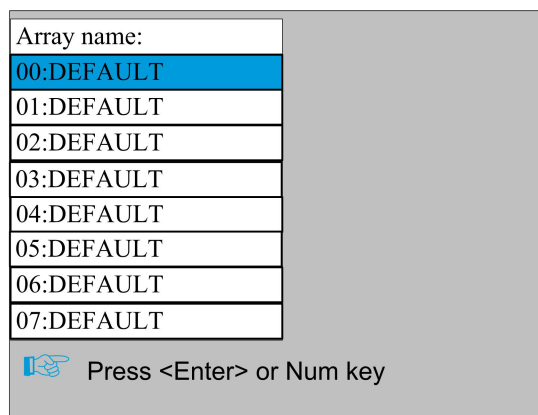


Figure 8.7.2-1

At this time, press the [up and down direction keys] to select the array. When the total number of arrays is greater than or equal to 2, the array information setting interface cannot

be operated. After selecting, press [Enter] to enter the array information setting interface as shown below:

Size	X: XX.XXX	X: XX.XXX	mm
Number	X: <input type="text" value="X"/>	X: <input type="text" value="X"/>	
Interval1	X: <input type="text" value="XXX"/>	X: <input type="text" value="XXX"/>	mm
Interval2	X: <input type="text" value="XXX"/>	X: <input type="text" value="XXX"/>	mm
Disloca	X: <input type="text" value="XXX"/>	X: <input type="text" value="XXX"/>	mm
Mirror	X: <input type="checkbox"/> H <input type="checkbox"/> V	Y: <input type="checkbox"/> H <input type="checkbox"/> V	


 Press <Enter> or Num key

Figure 8.7.2-2

At this time, the "blue selection block" stays on the first parameter to indicate that the parameter is selected, and the number key and the delete key can be used to set and modify the parameters. Press the arrow keys to move the "Select Block" and select other parameters to modify. When the parameters are modified, press [OK] to save the parameters, press [Exit] to cancel the modification parameters, the interface disappears, and return to the upper interface.

### 8.7.3 Feeding para

Select the "Feeding para" entry in the above interface and press the <Enter> button, then the pop-up menu appears as follows:

Auto get feed length:	<input type="button" value="NO"/>	
Feed frequency:	<input type="text" value="XXXX"/>	
Feed length:	<input type="text" value="XXXX"/>	mm
Current feed length:	XXXX	mm


 Press <Enter> or Num key

Figure 8.7.3

At this time, the "blue selection block" stays on the first parameter to indicate that the parameter is selected, and the number key and the delete key can be used to set and modify the parameters. Press the arrow keys to move the "Select Block" and select other parameters to modify. When the parameters are modified, press [OK] to save the parameters, press [Exit] to cancel the modification parameters, the interface disappears and return to the upper interface.

## 8.7.4 Memory operation

Select the "Memory Operation" entry in the above interface and press the **<Enter>** button, then the pop-up menu appears as follows:

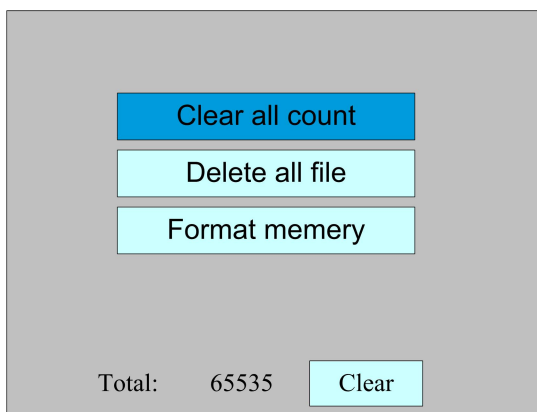


Figure 8.7.4

- **Clear all count:** To clear the running times of every file in the memory
- **Delete all file:** To delete all memory files
- **Format memery:** To format memory speedily, and then all the files in memory will be deleted.
- **Total:** the total running times of all the files.

Methods of operation are the same as above. Press the **<Esc>** key to return to the previous menu.

## 8.7.5 Format memery

Select the "Format Memory" entry in the above interface and press the **<Enter>** button, then the pop-up menu appears as follows:

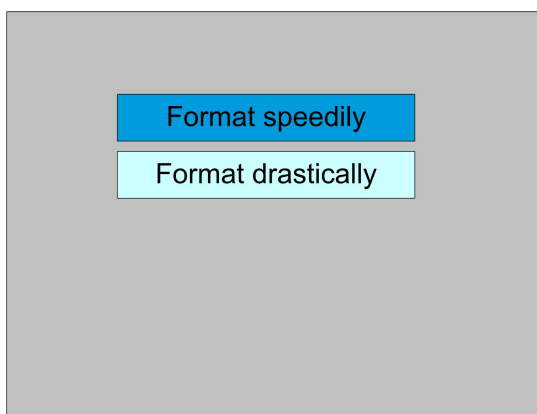



Figure 8.7.5

- **Format speedily:** To format memory speedily, and then all the files in memory will be deleted.
- **Format drastically:** To format memory drastically, and then all the files in memory will be deleted.

Methods of operation are the same as above. Press the **<Esc>** key to return to the previous menu.


## 8.7.6 U disk file

If the “U disk” entry in figure 8.8-1 is pressed, the system will show as figure 8.8-4, and the operation method is all the same as figure 8.8-1.

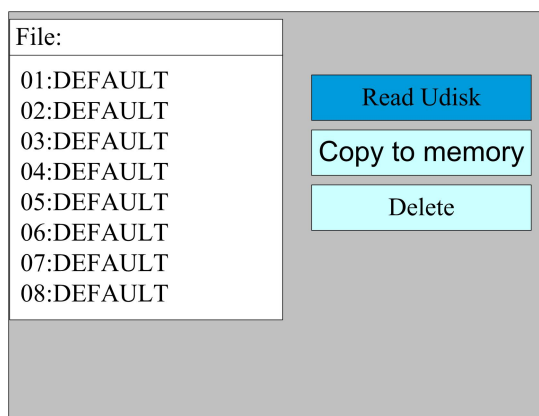

Figure

- **Read Udisk:** read the file list in the Udisk;
- **Copy to memory:** copy the target Udisk file to the memory;
- **Delete:** delete the selected Udisk file;

 <b>Prompt</b>	<p>This system supports such file formats of Udisk as FAT32 and FAT16, but it can identify them when the files are put under the root directory of Udisk. The file name of more than 8 characters will automatically be cut out by the system. The file name that has only English letters and digits will not show when they are copied to the mainboard. The files copied from the mainboard to Udisk will be placed under the root directory of Udisk.</p>
--	---

## 8.8 Password input and settings

### 8.8.1 Password Input

When you enter certain interfaces or perform certain operations, you need to enter the password. The interface is as follows:

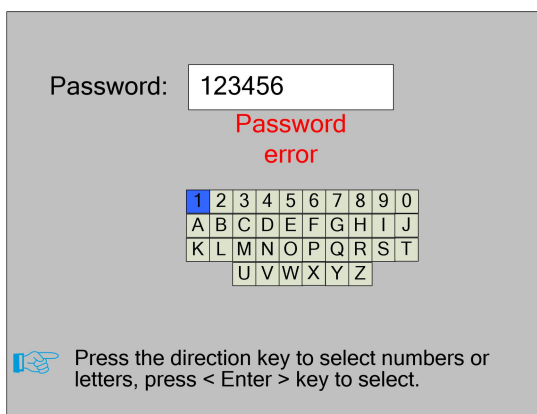


Figure 8.8.1

You can enter the password directly by pressing the number key, or you can select a number or letter by pressing the direction key, select by pressing the **<Enter>** key, and press the **<Enter>** key when you enter six passwords. If the password is correct, you can go to the next interface or perform the operation, otherwise you can display a "password error" and re-enter.

Press the **<Esc>** key to return to the previous menu.

### 8.8.2 Password Setting

The password settings interface is shown in the following figure:

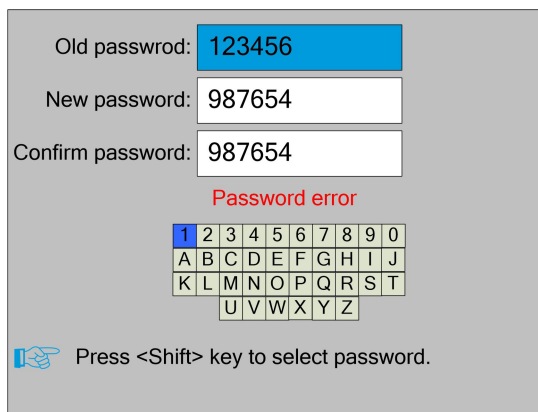


Figure 8.8.2

At this point, you can enter the password directly by pressing the number key, or you can press the **<Shift>** key to use the keypad, press the direction key to select a number or letter, press the **<Enter>** key to select, and then press the **<Shift>** key to return to the password selection. If the password is entered correctly, the new password will become effective, otherwise the "password error" will be displayed.


Press the **<Esc>** key to return to the previous menu.

## 8.9 Prompt and alarm information

In the process of user operation or system operation will pop up some hints and alarm information, such as reset, water protection failure, hard limit protection, border crossing and so on.

- Prompt

The system pop-up "The system is resetting.". show as below:

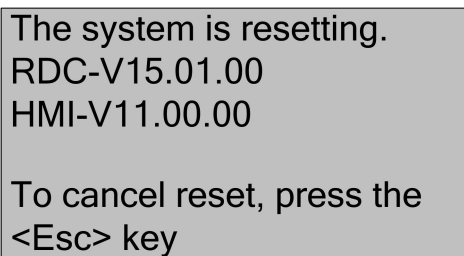A screenshot of a system prompt displayed in a grey rectangular box. The text inside the box is as follows:

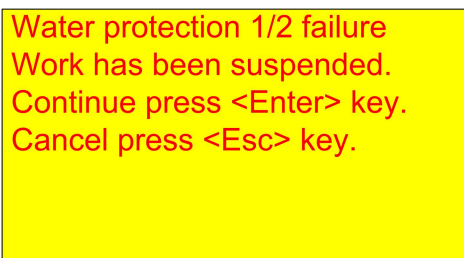
The system is resetting.  
RDC-V15.01.00  
HMI-V11.00.00  
  
To cancel reset, press the  
<Esc> key

Figure 8.9-1

The user operates according to the interface prompts.

- Alarm Information

The system generates "water protection fault", show as below:

A screenshot of a water protection fault alarm displayed in a yellow rectangular box. The text inside the box is as follows:

Water protection 1/2 failure  
Work has been suspended.  
Continue press <Enter> key.  
Cancel press <Esc> key.

Figure 8.9-2

At this point, the system performs related operations according to the **<Enter>** or **<Esc>** keys.

# Section 9

## Manufacturer/User Parameters Explanation

### CONTENTS:

-  Manufacturer parameters
-  User parameters

## 9.1 Manufacturer parameters

### (1) Motor parameters

#### *X~D axle parameters*

- **Direction Polarity:** Modification of direction polarity can move the motor to the opposite direction. The modification purpose can move this axle to the origin on resetting. If this axle moves far from the origin on resetting, it means the direction polarity of this axle is wrong in setting and should be modified.
- **Spacing Polarity:** it is used to set the high and low level mode of spacing signal. When the motion axle arrives at the spacing position and input a low-level signal to the mainboard, the spacing polarity at this time should be set to be minus.
- **scope:** it means the farthest distance that the motion axle can move, which is determined in accordance with the actual condition of the machine.
- **Distance from Origin to Hard Spacing:** if this axle enables hard-spacing protection, generally this value should be set to be 2~5mm; if it is set to be 0, when this motion axle moves to the smallest coordinate, i.e. 0, this spacing may be validate, which may wrongly triggers the hard-spacing protection and scam the machine. If the hard-spacing protection is not enabled, this value can be set to be 0~5mm.
- **Control Mode:** Double pulse or direction+single pulse are optional, in general, direction+single pulse is selected.
- **Motor Stepping:** it means the impulse equivalent, the absolute distance gone by the corresponding motion axle when a pulse is delivered to the motor. Prior to the correct setting of this value, a large rectangle can be cut with the machine (the larger the figure is, the smaller the difference is). The motor stepping can automatically be calculated according to the figure length and measuring length.
- **Hard-spacing Protection:** it is used for whether the hard-spacing protection of this axle is enabled.
- **PWM Rising edge valid:** To set the motor driver's pulse signal rising edge valid or falling edge valid. If this item is disabled, the pulse is falling edge valid, or, it's rising edge valid.
- **Reset Enable:** if the machine is provided with this axle, its "Reset Enable" should be opened; if no, its "Reset Enable" should be prohibited.
- **Takeoff Speed:** it means the speed of the motion axle in direct start from the idle condition. If this value is excessively large, it will make the motor lose steps, jar and even



squeak; if small, it will reduce the running speed of the whole figure. If the inertia of the motion axle is larger (the axle is heavier), you can set a smaller takeoff speed; if smaller (the axle is lighter), you can increase the takeoff speed. For example, the typical value is 5~30mm/s.

➤ **Maximum Speed:** it means the maximum limit of motion speed that this axle can bear. This parameter has something to do with the driving force of motor, the inertia of motion axle and its drive ratio. For example, the typical value is 200~500mm/s.

➤ **Maximum Acceleration:** it means the maximum acceleration of the motion axle in accelerated or decelerated motion. If the acceleration is set too large, it will make the motor lose steps, jar and even squeak; if too small, it will cause the reduction of acceleration so as to reduce the running speed of the whole figure. For the axles with larger inertia, such as Y axle corresponding to the beam, its typical setting range is 800~3000mm/s<sup>2</sup>; for the axles with smaller inertia, such as X axle corresponding to the car, its typical setting range is 8000~20000mm/s<sup>2</sup>.

➤ **Scram Acceleration:** if this axle enables the hard-spacing protection, when this axle moves to the spacing position, it will scam operation at the scam acceleration. This value can be 2~3 times of the maximum acceleration for this axle.

#### ***Key parameters***

➤ **Key Move Takeoff Speed:** it means the starting speed to move this axle by way of the keys on the keyboard, which can't be higher than the takeoff speed.

➤ **Key Move Acceleration:** it means the acceleration to move this axle by way of the keys on the keyboard, which can't be higher than the maximum acceleration of this axle.

➤ **Key Polarity:** it is used to control the movement direction of the axle that is moved through manual operation of the keys. After the direction polarity is correctly set, if you press the directional keys on the operating panel, this axle will move to the opposite direction. In such a case the polarity of keys should be modified.

#### (2) Laser parameters


➤ **Laser Configuration:** single laser and double lasers are available for option and set in accordance with the laser-tube quantity provided by the manufacturer.

➤ **Laser Type:** glass tube, RF laser (not need pre-ignition pulse) and RF laser (needing pre-ignition pulse) available for option.

➤ **Laser Attenuation Quotiety**

- **Laser Enable:** When double lasers are used, then each laser can be respectively enabled or disabled.
- **Minimum Power**
- **Maximum Power**
- **Laser PWM Frequency**
- **Pre-generation Frequency Enable**
- **Pre-generation Frequency**
- **Pre-generation pulse scale:** When the laser Pre-generation function is enable, then set the Pre-generation Frequency and the Pre-generation pulse scale.
- **Signal level:** To dedicate the valid level of opening laser signal. In RF-laser, the parameter is invalid, in glass tube laser, the ‘Low’ level is recommended.
- **Water Protector Enabled:** When the water protector is enabled, the mainboard will detect the input port of water protector. If this port is of low level, it will be deemed normal; if this port is of high level, the mainboard will forcibly close the laser to suspend the work in progress and the system will warn. If the water protector is not enabled, the mainboard will not detect the input port of water protector and so the water protector can be unconnected.

Laser PWM Frequency is used to set the pulse frequency of control signal used by this laser, in general, glass tube is about 20KHZ, RF laser is about 5KHZ; the maximum/minimum power (%) is used to set the limit power of this laser, that is to say, during the operation, the maximum power set by the user can't be higher than that set here and the minimum power set by the user can't be less than that set here, either. When a laser's power is attenuated, then the laser attenuation quotiety may be set

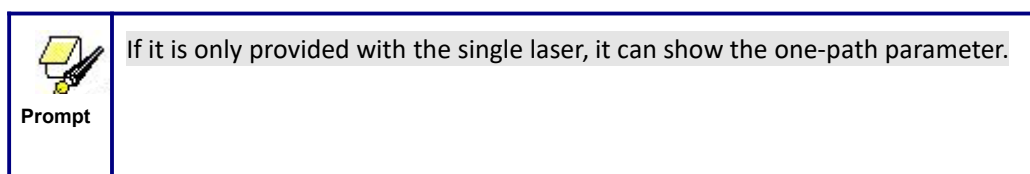

(3) Other manufacturer parameters

#### ***Machine configuration***

- **Machine Type:** In most cases, the general engraving machine should be selected and other types used for specific purposes.
- **Transmission Mode:** generally the “Belt Stepping Type” should be made choice of. The

control algorithm will be changed a little when other types are selected.


➤ **Feeding Mode:** it has single-way mode and two-way mode for option. If it is of single-way feeding, it is unnecessary to check the coordinates. Feeding can be conducted in the single-way mode; if it is of two-way feeding, the system will check the maximum and minimum coordinates. The odd sequence means feeding should be done to one direction and the even sequence means feeding done to the other direction. The initial direction for the first time can be changed through setting the directional polarity or modifying the plus and minus values of the feeding length.

➤ **Power-Off-Restart Delay:** it can be set to be 0~3000ms. After the power-off of the electricity grid, the power supply of the system will not drop to 0 at once. There is a delay during this time. The delay value set here should basically consistent with the actual off-delay value. If the deviation of set value is larger, on the de-energizing for continuous engraving, either the figure processed for the second time is not closed with that before the cutoff, or it is coincided with that too much.

➤ **Press Control:** if the machine has a pole to press the material on Y axes, then select press control, and, users can select the Y axis' home position based on machine.

➤ **Y-axis double driver:** if machine has two Y-motor driver, then enable Y-axis double driver.

➤ **Mirror cutting:** if machine has two X-motor, and they work back-to-back to cut some mirror graph, then select the mirror cutting function.

 <b>Prompt</b>	<p>After the configuration parameters in the manufacturer parameters, such as directional polarity, control mode, laser type and laser PWM frequency, are modified, the system should be reset. Such a modification can function upon the resetting of the system.</p>
--	--

#### ***Enable parameters***

➤ **Door Opening Protection:** If this item is enabled, then the door opening protection must be connected to the controller, or, the machine will not run.

➤ **Whether to enable the blower:** If using wind out port to control the blower by the graph layer parameter, this item must be enabled, or, the wind output is a signal for other using.

#### ***Multi-head auto layout parameters***

➤ **Head distance N:** This is the distance between the two X axis when they all return to

the absolute origin in the multi-head auto layout machine.

- **Multi-head number:** the number of the all x axes in the multi-head auto layout machine.
- **Driver type:** single belt or multi- belt are selected.

#### (4) Three-Color-Led Config Parameter

- **If Enable Three-Color-Led or Buzzer:** If enabled, the output ports in controller will drive the three-color-led and buzzer, then, these outputs be used to control other equipments.
- **Selecting in Idle/Run/Pause/Error Status:** In Idle/Run/Pause/Error Status, user can respectively select if turn on the led or buzzer.

## 9.2 User parameters

### (1) Cutting parameters(Only affect cutting arts)

- **Idle Move Speed:** this parameter decides the highest speed of all non-lighting lines for the machine in the movement process.
- **Idle Move Acceleration:** it means the highest acceleration of all non-lighting lines. Idle stroke speed and idle stroke acceleration can be set higher to reduce the working time of the whole figure, but if they are set too high, it may cause the jarring of track, so comprehensive consideration should be given to the setting.
- **Idle Move Delay:** If this parameter is zero, then after idle moving there is no delay, or, there is delay and the speed will decrease to turn off speed.
- **Turning Speed:** it means the speed of turning at the acute-angle corner, which is also the highest speed in the whole cutting process.
- **Turning Acceleration:** it means the acceleration of turning at the acute-angle corner when cutting. If the two speeds are set too high, jarring will happen to the turning; if set too low, it will influence the cutting speed. This acceleration is the least value of the whole graph.
- **Cutting Acceleration:** it means the highest acceleration value in the whole cutting process.
- **Acc Factor:** This parameter indicates how speedy the cutting acceleration is changing.
- **G0 Acc Factor:** This parameter indicates how speedy the idle move acceleration is changing.
- **Speed Factor:** This parameter indicates the cutting speed of the arc of various curvatures.

● **Key Setting:** This is a button but not a parameter, this button is used to recommend some experiential cutting parameters.

(2) Scanning parameters(Only affect scanning arts)

- **X-axe Starting Speed**
- **Y-axe Starting Speed**
- **X-axe Acceleration**
- **Y-axe Acceleration**


The above four parameters are used to set the starting speed and acceleration of two axes on the scanning. The higher the two speeds are, the quicker the scanning is.

➤ **Scanning Line-feed Speed:** this parameter is specially used to control the highest speed at which that the previous line vertically moves to the next line in the scanning mode. If the space between lines is larger during the scanning or if the distance of each block is larger during the scanning and deblocking of figure, it is necessary to position each line or block accurately. In such a case the speed of scanning line-feed can be set as a lower value.

➤ **Scanning Mode:** it is divided into general mode and special mode for option. If special mode is used, the laser power should be increased. The smaller the speckle percentage is, the more the laser focuses. The laser power to set should be larger in order to reach the same scanning depth. The purpose to select the special mode is to make the laser light at high power and short time. On the depth scanning the effect that the bottom is flatter is obtained, but it should be noticeable that if the speckle adjustment is not appropriate, it can achieve this goal. If the high power remains short, the lighting mode will influence the life of the laser. The system will default the selection of general mode.

➤ **Speckle Size:** When the general mode is selected as the scanning mode, this parameter will become ineffective; when the special mode is selected, this parameter will become effective. The controller will control this parameter among 50%~99%.

- **Engraving factor:** To punily change the speed of the engraving.

 <b>Prompt</b>	<p>The cutting and scanning parameters can't exceed the limited ones in the axle parameters. If so, the setting will become ineffective and the system will automatically cover the parameters with the axle parameters.</p>
--	--

(3) Feeding parameters

➤ **Before-feeding Time Lag:** settable at 0~300s. The lagged time can facilitate user's feeding and picking on the feeding device.

- **After-feeding Time Lag:** settable at 0~9.9s. It can facilitate the feeding device's delaying in jarring after moving to the correct position and waiting for the 2<sup>nd</sup> work after the feeding axle stands still completely.
- **Progressive feeding:** If this item is enabled, then the dummy array graph on Y direction will run in the same position, running one line graph, the U axes moving one time to feed, the moving length of U axes is the interval of the two lines graph on Y direction.
- **Progressive feeding repay:** Because of the imprecision of U axes' moving, there can set a value to repay the interval of the two lines graph on Y direction.
- **Last feeding:** If feeding when the last times work end.


#### (4) Reset parameters

- **Reset Speed:** it means the speed of X/Y-axle linkage reset to the origin.
- **Reset Speed of Z~D Axes:** the reset speed of Z~D axes go to the origin.
- **X~D axle start-up reset(Auto home):**

You can select "Yes" or "No" in the field of the above six parameters, which is used to confirm whether each axle can be reset on the startup.

#### (5) Go scale parameters

- **Go scale Mode:** "Blanked Bordering" means idling to start border preview; "Outputted Border Cutting" can manually cut off the well-processed figure; "4-corner Dotting" means to emit the light at four corner points of the frame to make a point and turn off light. The size and position of this figure can be checked intuitively through the four points. The bordering speed is the speed value set on the keyboard when the system is idle. For light output, its minimum/maximum power is the corresponding value set on the keyboard when the system is idle (The lasering power on the 4-corner dotting means the well-set maximum power).
- **Go scale Blank:** It means whether to extend a certain length outside the actual frame of the figure on the preview/cutting of frame.

 <b>Prompt</b>	<p>If the frame crosses the border, the interface will prompt it. If the Enter key is pressed at this time, the system will cut the border at the maximum/minimum coordinates first, and then border the figure. This bordering can be given up.</p>
--	--

#### (6) Other user parameters

- **Array Mode:** Two-way array or one-way array can be selected. Two-way array means the to-and-fro cutting of array in sequence; one-way array means the cutting of array from one

direction to another. On selecting one-way array, the elements of each array are the same in action mode and completely uniform in action fluency, which takes a little more time than two-way array. Two-way array is the default option.

- **Back Position:** The origin (the relative origin) and the machine's absolute origin can be selected. This parameter decides the parking position of laser head after each work.
- **Backlash X:** The X axes' backlash, accurate to 1um.
- **Backlash Y:** The Y axes' backlash, accurate to 1um.
- **Work Speed of Z~D axes:** the speed of each axes in work.
- **Focus Setting:** it means the distance from the focal point of laser head lens to Z-axle origin. When there is no automatic focusing function, this parameter becomes invalid.

#### (7) Rotating parameters

- **Enable Rotating:** If enable the rotating function of Y axis. If this parameter is enabled, the controller calculates the Y step length based on the circle pulse and the diameter of the work piece.
  - **Circle pulse:** the total pulse number sent by controller to make rotation axis finish one circle.
  - **Diameter:** The diameter of processing material which connected with rotation axis.
- **Test:** Press the button, fill it with speed value, start test of rotation axis. If the circle pulse is correct, the rotation axis can just finish one circle with it. This test can confirm the circle pulse number by testing if the circle pulse is correct.

#### (8) Wireless panel parameters

- **Enable Speed shift:** if the option is 'no', the axis speed of wireless keyboard movement is the speed value displayed on screen. If the option is 'yes', the axis speed of wireless keyboard movement is the speed value of fast movement or slow movement.
- **Fast moving(mm/s):** The fast grade speed when wireless keyboard axis moving.
- **Slow moving(mm/s):** The slow grade speed when wireless keyboard axis moving.

#### (9) Spraying Parameters

- **Point spraying mode:** when "continuous" is selected, press the [point spraying] button to start point spraying, and stop point spraying when it pops up; if "point spraying" is selected, press the [point spraying] button every time to carry out point spraying for a fixed time, which can be set.

- **Point spraying time:** total spraying time in point spraying mode.
- **Point spray opening time:** the opening time of spray valve in the process of single switch during point spray.
- **Point spray closing time:** the closing time of the spray valve in the process of single switch during point spray.
  
- **Enable nozzle control:** If yes is selected, it means that the up and down movement of the nozzle needs to be controlled; if no, it is not necessary to control the up and down movement of the nozzle.
- **Nozzle control mode:** if "IO mode" is selected, the up and down control of the nozzle is controlled by the cylinder; if "motor mode" is selected, the up and down movement of the nozzle is realized by the motor.
- **Spray offset X / Y:** indicates the offset value of the nozzle from the laser head in the X / Y direction. If the nozzle is in the positive direction of the laser head, the offset value is positive; if the nozzle is in the negative direction of the laser head, the offset value is negative.
- **Cylinder falling / lifting delay:** indicates the switch delay value of the cylinder used to control the up and down movement of the spray valve.
- **Delay of pressing down / lifting:** indicates the switch delay of pressing signal..
  
- **Enable fixed drop function:** if it is "yes", the controller will drive XY axis to the fixed drop point coordinate every other fixed time when the system is idle, and then spray a fixed time for cleaning the nozzle. If it is "no", the drip setting function is not enabled.
- **XY coordinate of fixed dropping point:** the coordinate value of XY axis of fixed dropping point when the fixed dropping function is enabled.
- **Fixed drop interval time:** when the fixed drop function is enabled, every fixed time, fixed drop once.
- **Fixed drop dispensing time:** when the fixed drop function is enabled, the dispensing time at each fixed drop.



Thank you for your selection of our production!

All the copyright of this manual is owned by Ruida technology. Any person or company can not copy upload and send the manual without Ruida's permission.

Content will be revised or modified. We will not send message to every users.

If there are any question or suggestion about our products and manuals, please tells us.

Tel: (086)0755-26066687

Fax: (086)0755-26982287

Adress: 3th floor,Technology Building,NO.,1067 Nanhai Avenue,Nanshan District,Shenzhen city,Guangdong Province,P.R.China

Website: [www.rd-ac.com](http://www.rd-ac.com)